 


34211 Katy Freeway BROOKSHIRE, TX 77423

Main - (281) 239-7383 Service - (281) 239-7383 Fax - (281) 239-7383


Invoice

R081004956:01

R0810049561
ORIGINAL
Date

1/10/2019

Billing Type
SR
V.I.N
1NPTL4EX48D740259
Year 2008

Make PETERBILT

Model CONVENTIONAL

Owner
Engine Model
Engine Model #
Trans Model
Trans Model #
Customer Unit #

Date In	Date In Service	Mileage	Date Out	Engine Hrs	Terms	Writer	Customer PO#
12/14/18	12/31/99	31,588	12/14/18	6,487	CASH	664	

Job#1 REPAIR
CUSTOMER REQUEST
Condition C/A CHECK ENGINE LIGHT STOP ENGINE LIGHT ON

Cause

Correction Customers complaint check engine light on. Drove truck in shop hooked laptop found active code 1922 dpf soot level high dpf plugged up. Removed step side box that cover dpf. Removed dpf from unit separated doc from dpf was sent out to be cleaned and doc was cleaned. Installed clean dpf on clean doc installed new gaskets on dpf. Installed dpf back on unit put new gaskets on exhaust pipes that go to dpf. Ran unit checked for any leaks from dpf or exhaust pipes no leaks found. Installed step side box back on. Reset dpf clean with laptop. Drove unit out the shop ran parked regen unit completed proper regen code went inactive cleared code unit good. Repair complete.

Qty	Item	Description	Build	Price	Extended
		LABOR TO PERFORM REPAIRS			607.50
1	081C/4388410	MODULE, PARTICULATE FILTER	NOLOC	1,744.29	1,744.29
2	081P/2866337CUM	GASKET-EXHAUST CIRCULAR 5"	S829A	6.66	13.32
3	081P/2871453CUM	GASKET-DPF ASSY	P801	23.93	71.79
1	081P/90-0013	CLAMP-V BAND 5"	S801	14.33	14.33
1	CUMMIN	FLEETCAL		108.33	108.33
Total Labor		607.50	Total Parts	1,952.06	Total 2,559.56

Job#2 repair
CUSTOMER REQUEST
Condition Service Brake Switch missing

Cause

Correction Customer truck was missing the cummins service brake switch, not allowing the truck to regen. I installed a new brake switch and tested operation. system is now functioning properly

Qty	Item	Description	Build	Price	Extended
		LABOR TO PERFORM REPAIRS			202.50
1	081P/16-09156	SWITCH-PRESSURE NORM OPEN	NOLOC	42.66	42.66
Total Labor		202.50	Total Parts	42.66	Total 245.16



34211 Katy Freeway BROOKSHIRE, TX 77423

Main - (281) 239-7383 Service - (281) 239-7383 Fax - (281) 239-7383



Invoice

R081004755-01

R0810047551

ORIGINAL

Date

11/30/2018

Billing Type

SR

V.I.N

1NPTL4EX48D740259

Year 2008

Make PETERBILT

Model CONVENTIONAL

Owner

Engine Model

Engine Model #

Trans Model

Trans Model #

Customer Unit #

Date In	Date In Service	Mileage	Date Out	Engine Hrs	Terms	Writer	Customer PO#
9/6/18	12/31/99	31,588	9/6/18	6,487	CASH	2051	

Job#1 REPAIR

CUSTOMER REQUEST

Condition C/A ENGINE MISFIRE AND WHITE SMOKE

Cause

Correction

Customer complaint of engine misfire and white smoke. I pulled the truck into the shop and ran diagnostic test to find the problem, I found that injectors 1&2 had piston to injector contact damage. we also found that their was progressive damage after the piston to injector contact damage occurred, engine needs overhaul, customer approved overhaul. I then drained coolant and a/c from the truck. I then drained the oil and removed all air intake piping. I then removed the hood and radiator from the truck. Once the radiator was removed I then removed all accessory drive units from the front of the engine. I then removed the turbo, thermostat housing and exhaust manifold. I then removed the intake manifold crankcase filter assembly and IFSM fuel module. I then removed all injectors, I then removed the injector rocker assembly and valve rocker assembly. I then removed front gear cover and removed valve camshaft gear and injector camshaft gear. I then removed all 26 cylinder head bolts and removed the cylinder head. I then removed the oil pan and removed the oil suction tube, stiffener plate and oil pump. I then removed all j-jet nozzles and removed the piston from the block and removed all liners. I then inspected and cleaned the block deck. I then removed all main bearing caps and installed main caps with new bearings and torqued all 7 main caps to specification. I then installed 6 new liners into the block and checked for liner protrusion. I then installed new rod and pistons for cylinders 1&2 and installed new pistons onto rods 3-6. I then installed new piston rings onto the pistons and installed all pistons into the liners. I then installed rod caps with new bearings and torqued all six rods to specification. I then installed the oil pan with new gasket and torqued to specification. I then installed the new cylinder head onto the block with new gasket and torqued cylinder head bolts to specification. I then installed the valve camshaft and injector camshaft into the head and inserted timing wedge and pin. I then installed both gears onto the camshaft and set engine base timing and torqued gears to specification. I then installed valve and injector rocker assembly and torqued to specification. I then barred the engine over and set valves and injectors 1-6. I then installed Jake brake harness and installed valve cover with new gasket and torqued to specification. I then installed front gear cover with new gasket and torqued to specification. I then installed IFSM module and torqued to specification. I then installed intake manifold and crankcase assembly and torqued to specification. I then installed thermostat housing, exhaust manifold & turbo with new gaskets and torqued to specification. I then installed all accessory drive components. I then installed radiator assembly and air intake piping. I then installed harnesses and secured with zip ties. I then filled the truck with 12 gallons of oil and 12 gallons of coolant. I then primed the fuel system

Qty	Item	Description	Unit	Price	Extended
		LABOR TO PERFORM REPAIRS			6,325.00
-6	081C/4954888RX-CORE	(4062567D) INJECTOR	CORBIN	539.06	-3,234.36
-1	081P/5413782RX-CUM-CORE	HEAD, CYLINDER	CORBIN	625.00	-625.00
-2	081C/4059429RX-CORE	(4059429D) ROD, ENGINE CONNECTI	CORBIN	35.94	-71.88
14	081S/222290-388	CHV DELO 400 SDE 15W40CK-4 (3/	PR08	16.99	237.86
13	081S/EC3501	COOLANT-TRP ELC 50/50 JUG	DISFLR	9.99	129.87
1	081S/FS19624FLG	FILTER-FUEL/WATER SEP	PR02	18.78	18.78
4	081P/4985492CUM	NUT-HEX LOCKING	S8298	7.63	30.52

Jeld: 9327204

X:\UserForms\Service\Service Barcode Invoices\9_22_SVSLX_BO_4009 WITH BARCODE.rpt

Date Create: 9/5/2018 12:00:00AM

Date Update: 11/30/2018 3:00:01PM

Time Printed: 11/30/2018 3:03:46PM

Description

Price

Extended

NOTICE OF WARRANTIES

Any warranties on the products sold hereby are those made by the manufacturer, if any. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and CLEVELAND MACK neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said product(s).

We hereby certify that these goods were produced in compliance with all applicable requirements of Sections 6, 7, and 12 of The Fair Labor Standards Act of 1938, as amended, and of regulations and orders of the Administrator or Wage and Hour Division issued under Section 14 thereof.

NOTICE PURSUANT TO SECTION 70.001, TEXAS PROPERTY CODE

I am the person or an agent acting on behalf of the person, who is obligated to pay for the repair of the motor vehicle subject to the repair contract. I understand that this vehicle is subject to repossession in accordance with 9.503 of the Texas Business and Commerce Code, if a check or money order for repair on the vehicle is stopped, dishonored because of insufficient funds, no funds, or because the drawer or maker of the check or money order has no account or account on which it is drawn has closed.

SIGNATURE OF PERSON RESPONSIBLE OR FOR PERSON RESPONSIBLE

Signature here _____

Please Print your name _____

Misc. Charges	-1,513.00
Parts:	13,055.45
Labor:	6,505.00
Diagnostic:	0.00
Sublet:	0.00
Shop :	150.00
Taxes: 8.25 %	964.63
Total:	19,162.08

Please Remit Payment to:
 PERFORMANCE TRUCK
 1263 U.S. HWY 59 NORTH
 CLEVELAND, TX 77328

Description

Price

Extended

NOTICE OF WARRANTIES

Any warranties on the products sold hereby are those made by the manufacturer, if any. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and CLEVELAND MACK neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said product(s).

We hereby certify that these goods were produced in compliance with all applicable requirements of Sections 6, 7, and 12 of The Fair Labor Standards Act of 1938, as amended, and of regulations and orders of the Administrator or Wage and Hour Division issued under Section 14 thereof.

NOTICE PURSUANT TO SECTION 79.001, TEXAS PROPERTY CODE

I am the person or an agent acting on behalf of the person, who is obligated to pay for the repair of the motor vehicle subject to the repair contract. I understand that this vehicle is subject to repossession in accordance with 9.503 of the Texas Business and Commerce Code, if a check or money order for repair on the vehicle is stopped, dishonored because of insufficient funds, no funds, or because the drawer or maker of the check or money order has no account or account on which it is drawn has closed.

SIGNATURE OF PERSON RESPONSIBLE OR FOR PERSON RESPONSIBLE

Signature here _____

Please Print your name _____

Misc. Charges	0.00
Parts:	1,886.39
Labor:	810.00
Diagnostic:	0.00
Sublet:	108.33
Shop :	81.00
Taxes: 8.25 %	171.25
Total:	3,056.97

Please Remit Payment to:
PERFORMANCE TRUCK
1263 U.S. HWY 59 NORTH
CLEVELAND, TX 77328

R0810047551 continued

Job #1 REPAIR continued

Item	Description	Price	Extended
1 081P/3683537CUM	GASKET-EXH GAS RCH VALVE	SB298 11.06	11.06
1 081P/3683495CUM	SEAL,O RING	NOLOC 7.56	7.56
1 081S/FF2200FLG	FILTER-FUEL	PR02 22.78	22.78
1 081S/LF14000NNFLG	FILTER	PR05 48.09	48.09
2 081P/07-03286RUB	MOUNT-RADIATOR OE RUBBER	SB148 27.33	54.66
20 081B/PA16006	PK50 BLACK NYLON TIE	PA09 0.98	19.60
1 081C/4032194	KIT,VG ACTUATOR FITTING	NOLOC 126.23	126.23
3 081S/226502-721	CHV ATF MD-3 (12/1QTLR)	DIS16 4.53	13.59
1 081P/03-01568	GASKET-AXLE SHAFT	PR01 5.18	5.18
6 081C/4954888RX	INJECTOR	NOLOC 471.89	2,831.34
1 081P/5413782RXCUM	HEAD,CYLINDER	PR07 3,347.59	3,347.59
1 081C/4376174	KIT,OVERHAUL	NOLOC 4,482.68	4,482.68
1 081S/CV50633FLG	ELEMENT-CRANKCASE VENTILATION	PR03 57.32	57.32
1 081P/3683144CUM	CLAMP-V BAND	SB16 50.16	50.16
6 081P/4089405CUM	BEARING-ROD (SET)	SB08 69.97	419.82
2 081C/4059429RX	ROD,ENGINE CONNECTING	NOLOC 291.09	582.18
3 081K/1U5517	DISC	SB32 3.11	9.33
28 081X/089099107	WORTH BRAKE/PARTS CLEANER	DIS17 2.97	83.16
2 081P/K221-5086-8	O'RING	NOLOC 8.00	16.00
1 081P/105FBC	GREASE-MOTOR ASSY 10 OZ L0034-	DIS16 5.99	5.99
1 081S/82194PTX	GASKET MAKER-ULTRA GRY 3.5OZ T	DIS99 6.44	6.44
13 081S/222290-388	CHV DELO 400 SDE 15W40CK-4 (3/	PR06 16.99	220.87
2 081C/3911678	DOMEL,RING	SB33A 6.45	12.90
1 081C/3679102	SCREW,TWELVE POINT CAP	NOLOC 4.79	4.79
12 081P/4965698CUM	SCREW-HEX FLANGE HEAD CAP	SB298 5.92	71.04
2 081C/4059429RX-CORE	(4059429D) ROD,ENGINE CONNECTI	CORBIN 35.94	71.88
1 081P/5413782RXCUM-CORE	HEAD,CYLINDER	CORBIN 625.00	625.00
6 081C/4954888RX-CORE	(4062567D) INJECTOR	CORBIN 539.06	3,234.36
-13 COUPON	COUPON DISCOUNT 0917-3C75F	1.00	-13.00
-1 COUPON	COUPON DISCOUNT 0917-26080	1,500.00	-1,500.00
Total Labor 6,325.00		Total Parts 11,414.39	Total 17,739.39

VISUAL INSPECTION AND BASIC TROUBLESHOOTING

Job #2 q-insp-3

Condition	install lights on rear of truck
Cause	missing lights on rear of truck
Correction	i installed new pigtails and lights on the rear of the truck for the brake lights and reverse lights

Qty	Item	Description	Unit	Price	Extended
LABOR TO PERFORM REPAIRS					135.00
4	081X/STL43RB	LED TAIL LIGHT ROUND	DIS01	8.92	35.68
5	081X/A47PB	PIGTAIL RIGHT ANGLE FOR TAIL L	DIS01	0.67	3.35
2	081X/BUL43CB	LED UTILITY LIGHT ROUND WHITE	DIS01	16.89	33.78
6	081X/A45GB	GROMMET FOR 4 ROUND	DIS01	0.69	4.14
1	081X/VEL-057131	THIN WALL HEAT SHRINK TUBING 3	VELVAC	9.35	9.35
1	081X/VEL-058313-40	HT SHRNK BUTT CNTR 16-14 40 PA	VELVAC	15.63	15.63
1	081P/194BULB	BULB-AUTO INST T3-1/4 14V WEDG	SB16D	0.77	0.77
1	081X/MCL55RB	LED MARK LIGHT 2 RED	DIS01	3.83	3.83
Total Labor 135.00					Total 241.53
Total Parts 106.53					

VISUAL INSPECTION AND BASIC TROUBLESHOOTING

Job #3 q-insp-3

Condition	replace hood latch on driver side
Cause	broken hood latch
Correction	i removed the broken hood latch and installed new hood latch

Qty	Item	Description	Unit	Price	Extended
LABOR TO PERFORM REPAIRS					45.00
1	081P/L03-0001	HOOK-HOOD HOLDDOWN	SB01C	21.53	21.53
Total Labor 45.00					Total 66.53
Total Parts 21.53					