



Auburn, WA
206-443-8500
San Leandro, CA
510-638-8100

Richmond, VA
804-271-9356
North SLC, UT
801-292-2453

Houston, TX
713-434-0995

Toll Free
888-337-2444

SERVICE REPORT

DATE: 11-15-12

CUSTOMER		Mesquite Truckline		TRIP MILEAGE		1103	
CONTACT NAME & NO.							
ADDRESS							
Odessa Tx							
MAKE	MODEL	SERIAL NUMBER	HOURS		UNIT NUMBER		
Manitowoc	11000	1100 1029			110240		

SERVICE REQUESTED	Monitor LMI Not working

REPAIRS MADE	Drive To Odessa Tx
	Found operator had Drilled in to Monitor to mount C.B. Radio and Hook it up to 24 volts. Fried LMI Monitor.
	Replace Monitor and showed Operator where to mount CB

COMMENTS	Front Lower Glass broke out need to order
	Total mileage 1103 11-14-12 8.5 Hrs Travel
	1 night 1 night at Hotel 11-14-12 9.5 Hrs Travel
	11-15-12 3 Hrs On Job

PART NUMBER	QNTY	DESCRIPTION	INSTALLED	ORDERED
GG55E00028F1	1	Monitor	✓	
GG02C01054P1		Glass		

TECHNICIAN

CUSTOMER SIGNATURE



Auburn, WA
206-443-8500
San Leandro, CA
510-638-8100

Richmond, VA
804-271-9356
North SLC, UT
801-292-2453

Houston, TX
713-434-0995

Toll Free
888-337-2444

SERVICE REPORT

DATE: 7-22, 23, 20-13

CUSTOMER C Sh Schmidt Land		TRIP MILEAGE 249		
CONTACT NAME & NO. Sheldon 830-391-5392				
ADDRESS Jourdan TX 79026				
MAKE	MODEL	SERIAL NUMBER	HOURS	UNIT NUMBER
MANITOWOC	11000-1	11001029	1352	110240

SERVICE REQUESTED

REPAIRS MADE

Extended TRACICS, Removed BAD cable from front Drum
Tighten TRACICS, Put on ROSTER SHAVE 7-27-13 6:00-10:15 to TOM
ON JOB 10:15-5:30
Replaced main cable on hoist, Put on counter weights, Put in 40 x 10 foot
Bobbin Sections with Pinch Lines, Replaced main hoist Drum cable Guide
7-28-13 - 7:00-6:30 ON JOB
Put in Tip Put on BALL AND BLOCK, Reset computer with operators

COMMENTS

PART NUMBER	QNTY	DESCRIPTION	INSTALLED	ORDERED

TECHNICIAN

CUSTOMER SIGNATURE



Auburn, WA
206-443-8500
San Leandro, CA
510-638-8100

Richmond, VA
804-271-9356
North SLC, UT
801-292-2453

Houston, TX
713-434-0995

Toll Free
888-337-2444

SERVICE REPORT

DATE: 9-25-13

CUSTOMER <i>Schmidt Land Services</i>		TRIP MILEAGE		
CONTACT NAME & NO. <i>Sheldon</i>				
ADDRESS				
MAKE <i>Manitoux</i>	MODEL <i>M-11000</i>	SERIAL NUMBER <i>11001029</i>	HOURS <i>1565</i>	UNIT NUMBER

SERVICE REQUESTED

*Install original Hoosier Shave after repair
and bring replacement to Houston*

REPAIRS MADE

COMMENTS

PART NUMBER	QNTY	DESCRIPTION	INSTALLED	ORDERED

TECHNICIAN

CUSTOMER SIGNATURE

SERVICE REPORT

Date: 10-16-13

Customer's Name: SCHMIDT Land Services

Customer P. O. # _____

Job Location: Willow St
Jourdawn Tr

M/M/T: MANITOWOC
11000-1

Hours: 1589

Equipment # 110240

Serial # 11001029

Describe Defects & Cause of Failure: MAN cable to short

Repairs Completed: Removed old cable from MAN WINCH

Replaced 772 ft of New cable

Loaded old cable on truck to take back to JARD
Cable good for Aux winch

Qty	Part Number	Description	Ordered	Installed
1				

Recommendations: _____

Technician: Greg Smith

Customer Name: J Alex Gillham

Customer Signature: JA

Job Complete:

Labor: Reg 6:45 - 10:00

Yes ☒ No ☐

O.T. _____

BIGGE

Established 1916

CRANE and RIGGING CO.

14800 Jersey Shore Dr.
Houston, TX 77047
(713) 434-0995

SERVICE REPORT

Date: 5-18-15

Customer's Name: _____

Customer P.O. # _____

Job Location: Bigge Shop

M/M/T: M11000-1

Hours: 3,355

Equipment # 110240

Serial # 11001029

Trip Mileage _____

Describe Defects & Cause of Failure: Make Repairs for Rent

Repairs Completed: Remove + install new boom hoist cable, cut damaged cable for auxillary winch, removed damaged parts off boom tip, install new parts; sheaves, sheave guard, pull A2B cable off reel, removed covers off block, Marcus relaid wire rope onto main winch, cut damaged wire rope from aux wire rope, reconnect wedge + bucket, remove + replace sheaves w/ new grease, removed main boom reel + communication cable, attempted to repair cable reel for A2B, needed to replace. Replaced cable guide on boom tip for main, repair cable end on auxillary bucket

Qty	Part Number	Description	Ordered	Installed
1		Cable Reel for Cable		

Recommendations: _____

Technician: Marcus Price, Daniel Cantu, Leroy Smith, Edwin Rodriguez

Customer Name: _____

Job Complete: _____

Labor: Reg _____

Customer Signature: _____

Yes ☐ No ☐

O.T. _____

Copies: White: Office

Pink: Customer

Yellow: Technician Copy



CRANE and RIGGING CO.

Established 1916

14800 Jersey Shore Dr.
Houston, TX 77047
(713) 434-0995

SERVICE REPORT

Date: 11/18/15
Customer's Name: RDL Trans Customer P.O. # _____
Job Location: ECR 123 milland TX M/M/T: M-11000-1 Hours: 3528
Equipment # 110240 Serial # 11001029 Trip Mileage _____

Describe Defects & Cause of Failure: Main controller override Inop.

Repairs Completed: Remove switch override switch cover

I Found override switch Bypassed with jumper wire.
Removed jumper wire.

Test override : ok.

Override to controller 1 is ATAS Factory

Qty	Part Number	Description	Ordered	Installed

Recommendations: _____

Technician: [Signature]

Customer Name: Austin Seto

Customer Signature: [Signature]

Job Complete: Labor: Reg _____

Yes ☒ No ☐ O.T. _____

Copies: White: Office

Pink: Customer

Yellow: Technician Copy



14800 Jersey Shore Dr.
Houston, TX 77047
(713) 434-0995

SERVICE REPORT

Date: 12-3-16

Customer's Name: RDL Transport.

Customer P.O. # _____

Job Location: Pecos, TX

M/M/T: Manitowoc 11000-1

Hours: 5358

Equipment # 110240

Serial # 1101029

Trip Mileage _____

Describe Defects & Cause of Failure: A2B switches not working / ~~lost~~ computer codes.

Repairs Completed: check A2B switches, both working; check ~~wiring~~ wiring in head section, looks good & tests good. Test crane with dummy plugs, tests good. Test crane with new cable reel, problem went away & ~~A2B~~ A2Bs work correctly. Install new cable reel in crane & secure to ~~boom~~ boom. Boom crane up & retest, all tests good & functions correct.

Qty	Part Number	Description	Ordered	Installed
<u>1</u>		<u>boom electrical reel & cable</u>		

Recommendations: _____

Technician: Bradley Wick

Customer Name: RDL Transport.

Customer Signature: Cecil Redd

Job Complete: _____

Yes ☒ No ☐

Labor: Reg _____

O.T. _____



14800 Jersey Shore Dr.
 Houston, TX 77047
 (713) 434-0995

SERVICE REPORT

1014028705

Date: 07-16-18

Customer's Name: _____

Customer P.O. # _____

Job Location: Houston

M/M/T: 1100 Man. Tons

Hours: 8676

Equipment # 110240

Serial # 11001029

Trip Mileage _____

Describe Defects & Cause of Failure: Off rent repairs

Repairs Completed: Repaired cab door (door was not unlatching)
Replaced sun visor, Replaced new manual binders. Replaced
load chart, Wiper blade was removed & replaced, Replaced
Wiper Fluid Hose leak. Removed & replaced fire extinguisher,
Serviced the batteries. Installed the battery hold
down. Replaced joystick covers, Put a new A2B switch in the
tool box, Removed excess oil from the oil drums, Installed
left rear drum guard, Removed the boom drum oil sight
glass, cleaned the sight glass & reinstalled. Angle indicator
arm repaired, Installed the front drum guard. Adjusted
all drum pawl locks, Put new becket in the tool box,
New bolts were welded on the track shims cover plates, Replaced
ext/ret bar locking pins, Replaced the bypass plug to the boom
reel, Replaced the axel extension locks

Qty	Part Number	Description	Ordered	Installed

Recommendations: _____

Technician: [Signature]

Customer Name: _____

Customer Signature: _____

Job Complete:

Yes ☒ No ☐

Labor: Reg _____

O.T. _____



SERVICE REPORT 10 14 028705

Date: 7/16/18

Customer's Name: _____

Customer P.O. # _____

Job Location: Houston

M/MT: 1100 Manitowok

Hours: 8676

Equipment # 110240

Serial # 1100 1029

Trip Mileage _____

Describe Defects & Cause of Failure: off rent repairs

Repairs Completed: repaired hyd leak at the swing handle valve,
Adjusted the tracks, Replaced the inside door panel, Replaced
the arm rest, lubed the boom wire rope, greased the crane
Replaced the retract pins, Installed the car body pins,
Rear drum cable was removed + replaced, Replaced
the front drum cable end.

Qty	Part Number	Description	Ordered	Installed

Recommendations: _____

Technician: [Signature]

Customer Name: _____

Customer Signature: _____

Job Complete:

Yes ☒ No ☐

Labor: Reg _____

O.T. _____



14800 Jersey Shore Dr.
Houston, TX 77047
(713) 434-0995

SERVICE REPORT 10 14 028705

Date: 07-17-18

Customer's Name: _____

Customer P.O. # _____

Job Location: Houston

M/M/T: 1100 Manitowoc

Hours: 8676

Equipment # 110240

Serial # 11001029

Trip Mileage _____

Describe Defects & Cause of Failure: 500hr Service

Repairs Completed: Changed engine oil and replaced Engine oil filter. Replaced Fuel filter and both air filters (Inner and outer)

Qty	Part Number	Description	Ordered	Installed
1	VH5156072190	Engine oil filter	✓	✓
1	VH23304EV330	Fuel filter	✓	✓
1	AF25129	Inner air filter	✓	✓
1	AF25130	Outer air filter	✓	✓

Recommendations: _____

Technician: ALM

Customer Name: _____

Customer Signature: _____

Job Complete:

Yes ☒ No ☐

Labor: Reg _____

O.T. _____