

CUSTOMER SIGNATURE

SERVICE R	EPOR1			DA	TE: Off	126	1/2016
CUSTOMER		Ameco		TR	IP MILEAGE	4	/26/2016
CONTACT NAME & N	10.	Amedo			The second second		20/2010
ADDRESS			Jimmy Morse				
		1	105 Holiday Road, Belton	S.C. 29627			
MAKE		MODEL	SERIAL NUMBER	226738	HOURS		UNIT NUMBER
Grove		RT 875E		220700		9681	RS 7514
SERVICE REQUE	STED						
Customer complaint, A	A-B fault in co	mputor, cab tilt,	low speed swing not working	properly. And	d once when th	ne cab	would not go down
none of the crane fund	ctions would v	vork.	, , , , , , , , , , , , , , , , , , , ,				would not go down,
				- 100			
						6 1979	
REPAIRS MADE							
Got to the machine and	d found none	of the problems	s that were rteported. The cu	stomers mech	anic and I spe	nt sev	eral hours checking wiring
with that. I told their m	echanic to ex	ktend and retrac	system fau;t in the anti-two bl	em reoccurs.	This action wo	e were	no current problems
a short circuit caused t	by a nick in th	ne outer jacket of	of the length cable. All of the	other problems	s that were rep	orted	are hydraulic problems
caused by issues in the	e auxilliary va	lve bank. Cab t	tilt has its own valve but it us	es a path in the	e aux. valve ba	ank to	stroke the pump. Checked
that goes through that	valve one at	a time and the	s. Told the customers mecha one that works properly is th	anic that if pro	the pressure	at he	should work each function
that would tell us where	e to go for pa	rts replacement.		e one that has	the pressure :	SELISILI	g system locked up and
		10 200					
COMMENTS							
	ne for about 4	hours while the	e customers crew used the m	achine for thei	r normal opera	tions :	and there were no problems
while they ran the mac	hine.		- cacternore or ow about the fir	definite for the	r Hormar opera	tions a	and there were no problems
PART NUMBER	IONTY	DESCRIPTION			INOTALLED		LODDEDE DE
I ANT HUMBER	QNTY	DESCRIPTION	J		INSTALLED		ORDERED
					# 15W		
						_	
					-		
- 11							



Richmond, VA 804-271-9356 North SLC, UT 801-292-2453

CUSTOMER SIGNATURE

USTOMER			TRIP MILEAGE	
J. O. O. I.	AME	CO	IIII IIIIEEAGE	8/2/2016
ONTACT NAME & NO	0.		•	
DDRESS				
DD.11200		Anderson SC		
IAKE	MODEL	SERIAL NUMBER	HOURS	UNIT NUMBER
rove	875E		103	224 BE7514
		200 - 200 -		
ERVICE REQUES	STED			
d machine two block oked at a/c system a	is now working correctled to the condensor is now working	two block switch at the rooster sheave ly. or is leaking and is completely plugged fter new condensor is installed.		
EPAIRS MADE				
EPAIRS WADE				
COMMENTS				
	to take the 650 apart an	nd it seemed that the operator was hav	ring trouble with the swing fo	unction of this crane The
lsed this crane today to ustomer showed me to	he two coils that were re	nd it seemed that the operator was hav ecently repaced on the accessory valv	e bank when the crane wou	
sed this crane today t ustomer showed me t	he two coils that were re		e bank when the crane wou	
lsed this crane today to ustomer showed me to	he two coils that were re	ecently repaced on the accessory valv	e bank when the crane wou	
Jsed this crane today to ustomer showed me to	he two coils that were re	ecently repaced on the accessory valv	e bank when the crane wou	
ustomer showed me to	he two coils that were re	ecently repaced on the accessory valv	e bank when the crane wou	
sed this crane today t ustomer showed me tl eems like the swing pr	he two coils that were re	ecently repaced on the accessory valv will put gages on the swing hydraulics	e bank when the crane wou	
sed this crane today t ustomer showed me tl eems like the swing pr	he two coils that were roump may be at fault. It	ecently repaced on the accessory valv will put gages on the swing hydraulics	e bank when the crane wou after we work on the a/c.	ıldn't swing at all but it almo
sed this crane today t ustomer showed me tl eems like the swing pr	he two coils that were roump may be at fault. It	ecently repaced on the accessory valv will put gages on the swing hydraulics	e bank when the crane wou after we work on the a/c.	ıldn't swing at all but it almo
sed this crane today t ustomer showed me tl eems like the swing pr	he two coils that were roump may be at fault. It	ecently repaced on the accessory valv will put gages on the swing hydraulics	e bank when the crane wou after we work on the a/c.	ıldn't swing at all but it almo
lsed this crane today to ustomer showed me to eems like the swing pro-	he two coils that were roump may be at fault. It	ecently repaced on the accessory valv will put gages on the swing hydraulics	e bank when the crane wou after we work on the a/c.	ıldn't swing at all but it almo
lsed this crane today to ustomer showed me to eems like the swing pro-	he two coils that were roump may be at fault. It	ecently repaced on the accessory valv will put gages on the swing hydraulics	e bank when the crane wou after we work on the a/c.	ıldn't swing at all but it almo
lsed this crane today to ustomer showed me to	he two coils that were roump may be at fault. It	ecently repaced on the accessory valv will put gages on the swing hydraulics	e bank when the crane wou after we work on the a/c.	ıldn't swing at all but it almo
lsed this crane today to ustomer showed me to eems like the swing pro-	he two coils that were roump may be at fault. It	ecently repaced on the accessory valv will put gages on the swing hydraulics	e bank when the crane wou after we work on the a/c.	ıldn't swing at all but it almo



Richmond, VA 804-271-9356 North SLC, UT 801-292-2453

CUSTOMER SIGNATURE

CUSTOMER	A		TRIP MILEAGE	8/9/2016
CONTACT NAME & NO	Ameco D.			6/9/2010
ADDRESS				
MAKE	MODEL	SERIAL NUMBER	lucupo	LINUT NUMBER
	MODEL	SERIAL NUMBER	HOURS	UNIT NUMBER
Grove	RT875E			275 3 7514
SERVICE REQUES	TED		THE PARTY OF THE P	
Removed condensor/fa	n unit from machine. Repla	ced condensor and dryer. Installe	ed rebuilt condensor/fan uni	t back on the machine,
/acuumed a/c system t	hen recharged with coolant.	System is now cooling.		
	•			
REPAIRS MADE				
COMMENTS				
COMMENTS				
New tube for dryer to co		up and I told the customer to leave	e it in the machine and wher	n any work is done to the
New tube for dryer to co		up and I told the customer to leave	e it in the machine and when	n any work is done to the
New tube for dryer to co		up and I told the customer to leave	e it in the machine and when	n any work is done to the
New tube for dryer to co		up and I told the customer to leave	e it in the machine and wher	n any work is done to the
		up and I told the customer to leave	e it in the machine and when	n any work is done to the
New tube for dryer to co		up and I told the customer to leave	e it in the machine and when	n any work is done to the
New tube for dryer to co		up and I told the customer to leave	e it in the machine and wher	n any work is done to the
New tube for dryer to co system, we can replace	that tube.			
New tube for dryer to co system, we can replace			e it in the machine and when	n any work is done to the
New tube for dryer to co system, we can replace	that tube.			
New tube for dryer to co system, we can replace	that tube.			
New tube for dryer to co	that tube.			
New tube for dryer to co system, we can replace	that tube.			
New tube for dryer to co system, we can replace	that tube.			
New tube for dryer to co system, we can replace	that tube.			
New tube for dryer to co system, we can replace	that tube.			
New tube for dryer to co system, we can replace	that tube.			
New tube for dryer to co system, we can replace	that tube.			



CUSTOMER			TRIP MILEAGE	
	Ameco/Bigge			10/25/2016
CONTACT NAME & NO.				
ADDRESS				
MAKE	MODEL	SERIAL NUMBER	HOURS	UNIT NUMBER
Grove	RT 875 E		226738	10389 RS 7514
SERVICE REQUESTI	ED			
Looked over machine and	filled out off rent paperwo	rk.		
Set machine up for shippir	ng tomorrow, still have c/w	hanging on the rear and will on	y remove it if necessary f	or shipping. The cable i
spooled up on the drum at the swing problem and fix	it before the next iob. Cus	nnected. There is no customer stomer reports that the hotter the	machine gets, the more	throttle it takes to get th
to swing.	Doroto trio front job. Ode	tomor reporte that the notion the		star it takes to get th
REPAIRS MADE				
COMMENTS	The second secon		The second secon	
PART NUMBER	QNTY DESCRIPTION		INSTALLED	ORDERED
				74
				A.1
		CONTRACTOR OF THE PROPERTY OF		
ECHNICIAN			CUSTOMER SIGN	NATURE



Richmond, VA 804-271-9356 North SLC, UT 801-292-2453

CUSTOMER SIGNATURE

SERVICE RE	PORT		DA	TE:	
CUSTOMER	Piggs	sarconita li alexani, Cali di Il sance esta di California	TR	P MILEAGE	10/28/2016
CONTACT NAME & NO.	Bigge				10/20/2010
ADDRESS					
MAKE	MODEL	SERIAL NUMBER		HOURS	LINITALIMBED
_		SERIAL NOMBER	226738	HOURS	UNIT NUMBER
Grove	RT875E				BE 7415
SERVICE REQUEST	ED	THE RESERVE THE PARTY OF THE PA			
Got crane in to a place in	Charleston, unloaded it a	and installed the c/w.			
accessory valve.	g problem and feel that th	ne best thing to do at this point	is to replace	the "metering" v	alve in the swing, steer, and
Also need a gage for the					
Also need a windshield w	iper blade for the top wind	dow. (tree damage from shippir t make it to Charleston althoug	ng) ih Lam sure i	was on the cro	ne when it left The ich site
raco nece an operators c	as goor. The goor did no	make it to chaneston aithoug	ni i ani sule l	was on the crai	ne when it left The Job Site
REPAIRS MADE					
		d the shipping company of the			
		or weldments were available at etc. I am waiting for the deale			
I did get the valve cartride	ge number from cranecar	e today and we need to order the	his valve.	a parts diagram	30 i cali order all the parts.
The cartridge number is 9	926112772 Grove numb	per			
I am having trouble identi exactly the same.	fing parts because there	are no parts books for this exac	ct type af crai	ne, an RT880E	is very close but it is not
exactly the same.		The second second second second second			
		The second second second	A LANGE TO SE		
COMMENTS		. 0			
The crane is currently in a The Address is: Parker M		ere in Charleston.			
68 Braswe					
Charlestor	n S.C. 29405				
PART NUMBER	QNTY DESCRIPTION	N		INSTALLED	ORDERED
-					



CUSTOMER SIGNATURE

	THE RESIDENCE OF THE PARTY OF T	THE RESERVE THE PARTY OF THE PA	TRIP MILEAGE	N T T T T T T T T T T T T T T T T T T T
STOMER	Bio	gge		10/31/2016
NTACT NAME & NO.		99-		
DRESS				
	MODEL	SERIAL NUMBER	HOURS	UNIT NUMBER
AKE	MODEL	224738		BE 7514
ove	RT875E	220130		
				/ / / / / / / / / / / / / / / / / / / /
ERVICE REQUES		ne is) and got permission to power wash	the machine. Went to ven	dor and rented a self
ent to Parker Marines	g machine Went h	ne is) and got permission to power washinack to Parker Marine and set machine the	crane up so I could powe	r wash it.
ntained power washin	yorking while I was y	ack to Parker Marine and set machine the washing the machine and I was only able	to get the bottom of the ma	achine clean. Closed th
			and made sure we were r	not charged for the renta
ane up and parked it if	dor and got hoom o	grease and gear oil for tomorrow.		
ent to an oil supply ver	ndor and got boom g	grease and gear of the		THE RESERVOIR DESCRIPTION OF THE PERSON OF T
				Control of the second
EPAIRS MADE				
EPAIRS WADE				The second second
The state of the s				
1 1 1 1 1				
			The second secon	
		- 1 33-14-15-15-1		
C 1 25 to 12				
<u> </u>				
1 200 11				
COMMENTS				
			INSTALLED	ORDERED
	QNTY DESC	CRIPTION	INSTALLED	ORDERED
COMMENTS PART NUMBER	QNTY DESC	CRIPTION	INSTALLED	ORDERED
	QNTY DESC	CRIPTION	INSTALLED	ORDERED
	QNTY DESC	CRIPTION	INSTALLED	ORDERED
	QNTY DESC	CRIPTION	INSTALLED	ORDERED
	QNTY DESC	CRIPTION	INSTALLED	ORDERED
	QNTY DESC	CRIPTION	INSTALLED	ORDERED
	QNTY DESC	CRIPTION	INSTALLED	ORDERED
	QNTY DESC	CRIPTION	INSTALLED	ORDERED
	QNTY DESC	CRIPTION	INSTALLED	ORDERED
	QNTY DESC	CRIPTION	INSTALLED	ORDERED
	QNTY DESC	CRIPTION	INSTALLED	ORDERED
		CRIPTION	INSTALLED	ORDERED



Richmond, VA 804-271-9356 North SLC, UT 801-292-2453

came out. Took gag	SERIAL NUMBER red dashboard to replace the volves to auto parts vendor and tried he non working back up light and	to buy some gages.	UNIT NUMBER BE 7514 the rpm gage was also broken an Could not buy anything that woul
RT875E	red dashboard to replace the vol	Itage gage and found	BE 7514
RT875E	red dashboard to replace the vol	Itage gage and found	BE 7514
om sections. Remov	es to auto parts vendor and tried	to buy some gages.	the rom gage was also broken an
came out. Took gag	es to auto parts vendor and tried	to buy some gages.	the rpm gage was also broken an Could not buy anything that woul
came out. Took gag	es to auto parts vendor and tried	to buy some gages.	the rpm gage was also broken an Could not buy anything that woul
16			
TY DESCRIPTION		INSTALLE	ORDERED
The second secon			100
	TY DESCRIPTION	TY DESCRIPTION	TY DESCRIPTION INSTALLE



Richmond, VA 804-271-9356 North SLC, UT 801-292-2453

CUSTOMER SIGNATURE

SERVICE RE	FURI		DATE:	
USTOMER			TRIP MILEAGE	11/4/2016
ONTACT NAME & NO	Bigge .			11/4/2010
DDRESS				
DDKE39				
IAKE	MODEL	SERIAL NUMBER	HOURS	UNIT NUMBER
rove	RT 875 E			BE 7514
ecame more responsive swing function acts useplaced the tach and the tach and the true true to the throtte services. EPAIRS MADE	e and smoother. Just to be up again. he battery gage and then re le is pushed, I don't know if	Replaced the flow divider valve on the safe side, I ordered a new installed the dashboard. The batis is really working. The rpm was new upper windshield wiper and	ew swing brake valve and co attery gage reads 13.5 volts s a different design and I ha	all the time and does not do to figure out the wiring
ART NUMBER	QNTY DESCRIPTION		INSTALLED	ORDERED



		BIGGE		TR	P MILEAGE	1/3/2017
NTACT NAME & NO		BIGGE				
DRESS						
		MODEL	SERIAL NUMBER		HOURS	UNIT NUMBER
AKE	ľ	NODEL	OLIVIAL ITOMIC LIV			409 BE 7514
ove					10	409 32 70 7
ERVICE REQUES	TED		Control of the Contro			
stalled door on cab. I	nstalled windo	ow in door.				
						
					11	
EPAIRS MADE						
	CONTRACTOR ACTION					
COMMENTS						
COMMENTS						
COMMENTS						
COMMENTS						
COMMENTS						
COMMENTS						
	IONTY	DESCRIPTION			INSTALLED	ORDERED
COMMENTS PART NUMBER	QNTY	DESCRIPTION			INSTALLED	ORDERED
	QNTY	DESCRIPTION			INSTALLED	ORDERED
	QNTY	DESCRIPTION			INSTALLED	ORDERED
	QNTY	DESCRIPTION			INSTALLED	ORDERED
	QNTY	DESCRIPTION			INSTALLED	ORDERED
	QNTY	DESCRIPTION			INSTALLED	ORDERED
	QNTY	DESCRIPTION			INSTALLED	ORDERED



SERVICE REPORT
Date: 6-618 Customer's Name: 29C47 Customer P.O. # Job Location: Beaumont M/M/T: 1+Grove Hours: 10925 Hours: 10925 Equipment # Be 7514 Serial #
Describe Defects & Cause of Failure: hoses leaking
δ
Repairs Completed: Beplaced hose from Valve block to acum vlator & hose from Valve block to counter weight
Qty Part Number Description Ordered Installed
2 Hydravlic hoses
Recommendations:
Technician: Learn Herrichy Customer Name: Job Complete: Labor: Reg Customer Signature: Yes \(\bar{\text{No}} \) No \(\bar{\text{No}} \)





SERVICE REPORT
Date: 6-28-18
Customer's Name: Customer P.O. #
Job Location: Beaumont MMT: Grove Rt 750 E Hours:
Equipment # Be 7514 Serial # Trip Mileage 98 miles Club
Describe Defects & Cause of Failure: Operator Son's telli Cylinder Was parking Retracting Repairs Completed: Set up dane 100 Ft Scaped out Boom Angel Cos let operator Run clane for an hour renght & Angle Settle Still the same Crane OK
Qty Part Number Description Ordered Installed
Recommendations: Technician: Customer Name: Yes No O.T. O.T.





	SERVICE REPORT		
Date: 7-18-18			
Customer's Name: Zachry	Customer I	P.O. #	
Job Location: Beaument			
Equipment # BE 7514	Serial # 226738 Trip M		
	The first state of the first sta		10.5
Describe Defects & Cause of Failure: _			
100 C			
		-	
Repairs Completed: 500 HR -) as		
			3
Change oil and	d all Filters Listed Below	1	
- 100			
		- No Roder	
			4
1-25129	outer Ajr		160
Qty Part Number	Description		Installed
1 FS 1063	Fuel water sep		~
1 LF 3970 1 5612 FF 1 25130	Lube Filter Evel Filter inner air	-	1
Recommendations:			
Technician: Day of Suka:			
Customer SERG'O TZU		Labor: Reg	
Customer Signature:	Yes No No	O.T	
	3.45% (III)		

Copies: White: Office

Pink: Customer

Yellow: Technician Copy





SERVICE REPORT						
	-5-18					
				omer P.O. #		
	ation: Houston					
Equipme	ent # BE 7514	Serial # 226738	1	Trip Mileage		
Describe	e Defects & Cause of Failure	e:				
da	mages, resealed	b fan, replaced bad fur bolant, cheeked all oth horn button on steen s just grease from rote, center pumps change hodd cover, put news or I coolant line, put I filter lines t fittings, dirt, put coone on a d leaking steering cylin	to on Seeks	t bud hose:	s, put	
Qty	Part Number	Description		Ordered	Installed	
Recomn	nendations:					
Technici	an: Joens V	7				
Customer Name:		Job Com	,	Labor: Reg		
Custome		Yes D	No 🔲	0.1		

Copies: White: Office Pink: Customer Yellow: Technician Copy