



Auburn, WA  
206-443-8500  
San Leandro, CA  
510-638-8100

Richmond, VA  
804-271-9356  
North SLC, UT  
801-292-2453

Houston, TX  
713-434-0995

Toll Free  
888-337-2444

## SERVICE REPORT

DATE: 7-12-2013

CUSTOMER		Irwin Industries		TRIP MILEAGE		64 miles 2 trips	
CONTACT NAME & NO.		Dana Stoller 424-731-2035					
ADDRESS		619 Anaheim St. Wilmington CA.					
MAKE	MODEL	SERIAL NUMBER	HOURS		UNIT NUMBER		
Terex	RT 345	161214	137		BE4524		

### SERVICE REQUESTED

Inspect & Repair Damage to Boom (2 Blocked) Head.

### REPAIRS MADE

Replace Main A2B Switch. Straighten Bent Sheave End Plates. Polish out marks in Lead Block Sheave. Remove 10ft from main cable. Mouse both main & Aux cable ends. Inspect the rest of boom components.

### COMMENTS

PART NUMBER	QNTY	DESCRIPTION	INSTALLED	ORDERED
Grease	1	Anti Two Block Switch	SG	7-12-2013
Shackle	1	1/4 A2B Chain	SG	7-12-2013

Steve Golden  
TECHNICIAN

CUSTOMER SIGNATURE





Auburn, WA  
206-443-8500  
San Leandro, CA  
510-638-8100

Richmond, VA  
804-271-9356  
North SLC, UT  
801-292-2453

Houston, TX  
713-434-0995

Toll Free  
888-337-2444

## SERVICE REPORT

DATE:

7-23-2013

CUSTOMER <i>Irwin Industries</i>		TRIP MILEAGE <i>20</i>	
CONTACT NAME & NO.			
ADDRESS			
MAKE <i>Texer</i>	MODEL <i>RT345 x4</i>	SERIAL NUMBER <i>161214</i>	HOURS <i>161</i>
		UNIT NUMBER <i>BE4524</i>	

### SERVICE REQUESTED

*Coolant leak*

### REPAIRS MADE

*Check cooling system, Tighten Hose clamps on Radiator,  
Run engine & check for other leaks. OK.*

### COMMENTS

PART NUMBER	QNTY	DESCRIPTION	INSTALLED	ORDERED
<i>Anti freeze</i>	<i>1 gal</i>	<i>coolant</i>		

*Steve Golden*  
TECHNICIAN

CUSTOMER SIGNATURE





Auburn, WA  
206-443-8500  
San Leandro, CA  
510-638-8100

Richmond, VA  
804-271-9356  
North SLC, UT  
801-292-2453

Houston, TX  
713-434-0995

Toll Free  
888-337-2444

## SERVICE REPORT

DATE: 7-30-13

CUSTOMER		Irwin Ind		TRIP MILEAGE		46 Miles round trip	
CONTACT NAME & NO.		April Prickett		310		629-3879	
ADDRESS Conocophlips wilmington							
MAKE	MODEL	SERIAL NUMBER	HOURS		UNIT NUMBER		
Terex	RT445		176		BE-4524		

SERVICE REQUESTED	Low Hyd oil and water leaking

REPAIRS MADE	None - Nothing wrong did not scope outriggers in to check oil - A/C had water drip - No coolant leak

COMMENTS	instructed operator How to check Hyd oil, had him scope everything in and boom down, right where it should be. A/C is going to drip if working correctly

PART NUMBER	QNTY	DESCRIPTION	INSTALLED	ORDERED

Bryce Hulet  
TECHNICIAN

  
CUSTOMER SIGNATURE





Established 1916  
**CRANE and RIGGING CO.**

14511 Industry Circle  
La Mirada, CA 90638  
(714) 670-9525

## SERVICE REPORT

Date: 2.16.14

Customer's Name: BIGGE Customer P. O. # \_\_\_\_\_

Job Location: HINKLEY M/M/T: TEREX/RT 345-1XL Hours: 571

Equipment # BE4524 Serial # 161214

Describe Defects & Cause of Failure: 500 HR SERVICE, SWING BRAKE ISSUE

Repairs Completed: 500 HR SERVICE

OIL/FILTER CHANGED

FUEL FILTERS

AIR FILTER

TRANSMISSION FILTER

ADJUSTED SWING BRAKE CABLE- LUBED ROTEX

4.5 GAL	DELO SW 40	SYNTHETIC ENGINE OIL		✓
Qty	Part Number	Description	Ordered	Installed
1	P182000	AIR FILTER		✓
1	P550848	FUEL FILTER		✓
1	FF5421	FUEL FILTER		✓
1	BT8832	TRANSMISSION FILTER		

Recommendations: \_\_\_\_\_

Technician: BRIAN GOMEZ

Customer Name: \_\_\_\_\_

Customer Signature: \_\_\_\_\_

Job Complete: \_\_\_\_\_ Labor: Reg \_\_\_\_\_

Yes ☒ No ☐ O.T. \_\_\_\_\_

### SERVICE REPORT

Date: 12-23-2014

Customer's Name: Bigge

Customer P. O. # \_\_\_\_\_

Job Location: LA Mirada

M/M/T: Terex

Hours: 1006

Equipment # BE 4524

Serial # 1161214

Describe Defects & Cause of Failure: Service engine filters

Repairs Completed: changed oil, fuel, air

New 7T down haul block (extra) is in back of yard.

Wiper upper had blown fuse.

4 gallons oil

Qty	Part Number	Description	Ordered	Installed
1	B 7177	oil		
1	BF 7966	fuel		
1	BF-1385 SPS	Fuel		
1	P182000	AIR		

Recommendations: \_\_\_\_\_

Technician: Rick

Customer Name: \_\_\_\_\_

Customer Signature: \_\_\_\_\_

Job Complete: \_\_\_\_\_ Labor: Reg \_\_\_\_\_

Yes ☒ No ☐ O.T. \_\_\_\_\_

**SERVICE REPORT**

Date: 7-7-15

Customer's Name: BCR

Customer P. O. # \_\_\_\_\_

Job Location: La Mirada

M/M/T: Terex / RT345-1XL

Hours: 1.51

Equipment # BE4524

Serial # 161214

Describe Defects & Cause of Failure: \_\_\_\_\_

Repairs Completed: Check outrigger monitor system, O.K. Set  
LMI to read potentiometers instead of CAN string pots.  
check operation, O.K.

Qty	Part Number	Description	Ordered	Installed

Recommendations: \_\_\_\_\_

Technician: [Signature]

Customer Name: \_\_\_\_\_

Customer Signature: \_\_\_\_\_

Job Complete: \_\_\_\_\_

Yes ☐ No ☐

Labor: Reg \_\_\_\_\_

O.T. \_\_\_\_\_



# BIGGE

CRANE and RIGGING CO.

Established 1916

10700 Bigge Ave.  
San Leandro, CA 94577  
(510) 638-8100

## SERVICE REPORT

Date: 12/18/17

Customer's Name: Harder

Customer P. O. # 10-02-031638

Job Location: Chertron

M/M/T: TEREX RT345-2XL

Hours: 2990

Equipment # BE4524

Serial # 161214

Describe Defects & Cause of Failure: CAB Fan Smashed for heater unit, Failure is from stacking wood onto fenders & swinging into wood on deck of crane.

Repairs Completed: Removed heater assy & Evaporator ASSY to repair sheet metal on cab & cab heat box assy replaced smashed cab heater tin with a good tin housing from a old cab heater reinstall heater & test ok

Qty	Part Number	Description	Ordered	Installed

Recommendations: Stack wood in the front of the crane only nothing goes on the fenders

Technician: Brian Cottingham

Customer Name: \_\_\_\_\_

Job Complete: \_\_\_\_\_

Labor: Reg 8hr

Customer Signature: \_\_\_\_\_

Yes ☒ No ☐

O.T. \_\_\_\_\_

Unit BE 4524 Terex RT345 1XL

Serial Number # 161214

On rent to Irwin Industries.

At Conoco Philips, Wilmington.

Job Number # 10-12-60188

Date 7-12-2013

List of charges from the shop.

1. Labor, 2.5 hours overtime \$ 375
2. Labor ,5.5 hours regular \$605
3. Greer Anti Two Block switch \$981.15 plus \$153.15 shipping . \$1134.30
4. Shop supplies \$19.60
5. HAZ MAT \$39.20
6. Travel cost \$144

Total \$2,317.10