

EQ0072504

**ZIEGLER CAT**901 West 94th Street  
Minneapolis MN 55420-4236**ZIEGLER CAT Rental**Minnesota 800-352-2812  
Iowa 800-342-7002  
Missouri 800-342-7002  
Wisconsin 800-342-7002**Service Invoice**Invoice SI000358737  
Date 7/18/2023  
Call Number SC00334289  
Location New Hampton  
Page 1 / 14Sold to: MACHINE INVENTORY ADD TO BV - AGRI  
ATTN: CORP MACHINE INVENTORY ACCOUNTANT  
901 W 94TH ST  
MINNEAPOLIS, MN 55420-4236Ship to 1819 MCCLLOUD AVE  
NEW HAMPTON, IA 50659-9303

<b>Invoice Account</b>	<b>Payment</b>	<b>Due Date</b>
I002845	Internal - No Payment	7/18/2023

<b>Customer PO</b>	<b>Customer EQ</b>	<b>Model</b>	<b>Serial Number</b>	<b>Equipment ID</b>	<b>Segment SMU</b>
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033.00

**Summary**

Parts	13,197.77
Labor	14,281.84
Misc	1,760.50

<b>Parts, Labor and Misc</b>	<b>29,240.11</b>
------------------------------	------------------

Flat Rate Total	0.00
-----------------	------

<b>Subtotal</b>	<b>29,240.11</b>
-----------------	------------------

Shop Supplies and Environmental Fees	1,272.79
---	----------

<b>Subtotal</b>	<b>30,512.90</b>
-----------------	------------------

<b>Sales Tax</b>	<b>0.00</b>
------------------	-------------

<b>Total</b>	<b>\$ 30,612.90</b>
--------------	---------------------

MACHINE INVENTORY ADD TO BV - AGRI  
ATTN: CORP MACHINE INVENTORY  
ACCOUNTANT  
901 W 94TH ST  
MINNEAPOLIS, MN 55420-4236

Please Remit to:

Ziegler Inc.  
SDS 12-0436  
PO BOX 86  
MINNEAPOLIS, MN 55486-0436Invoice SI000358737  
Date 7/18/2023  
Account I002845Amount Due: **\$30,612.90**

Amount Enclosed:

Invoice	Date	Call Number	Location	Page
SI000358737	7/18/2023	SC00334289	New Hampton	2 / 14

### SC00334289-001 Troubleshoot - Starting System

Customer complaint: Machine will not start  
Cause of failure: Gelled up  
Repair process comments: Put 911 in fuel tank  
Could not get machine to start  
Started machine off with a jug of fuel  
Got in to shop to thaw out

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033
Quantity Type	Part Number	Description		Unit Price	Amount
	Labor	Labor			692.00

SC00334289-001 Troubleshoot - Starting System

Parts	
Labor	692.00
Misc	
Segment Subtotal:	692.00

### SC00334289-002 Perform - Prevent Maint. Inspection

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033
Quantity Type	Part Number	Description		Unit Price	Amount
1.00 Parts	8080 - 148	DIESEL 911 80OZ		15.48	15.48
	Labor	Labor			

SC00334289-002 Perform - Prevent Maint. Inspection

Parts	15.48
Labor	275.00
Misc	100.00
Segment Subtotal:	390.48

Invoice	Date	Call Number	Location	Page
SI000358737	7/18/2023	SC00334289	New Hampton	3 / 14

#### SC00334289-004 Perform Maintenance On - Machine

Customer complaint: Perform whole machine service.

Resultant damage: NA

Cause of failure: NA

Repair process comments: Performed whole machine maintenance. Replaced serpentine belts. Replaced serpentine pulleys that were bad. Ran machine. Verified correct machine operation and no leaks. Task complete.

Customer complaint: Perform whole machine service.

Resultant damage: NA

Cause of failure: NA

Repair process comments: Performed whole machine maintenance. Replaced serpentine belts. Replaced serpentine pulleys that were bad. Ran machine. Verified correct machine operation and no leaks. Task complete.

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCCQ865VNWKG1001	EQ0072504	8,033
Quantity	Type	Part Number	Description	Unit Price	Amount
1.00	Parts	1R0716	Filter A	31.24	31.24
1.00	Parts	501772D2 - 200	AIR FITR.ELEMENT	155.91	155.91
1.00	Parts	501773D1 - 200	AIR FITR.ELEMENT	103.53	103.53
1.00	Parts	1R0749	Filter As Fu	26.11	26.11
1.00	Parts	3261643	Filter As	53.19	53.19
1.00	Parts	570072D1 - 200	AIR FILTER-65.4MM X	94.62	94.62
1.00	Parts	WWF - 210	WASH FLUID	2.23	2.23
1.00	Parts	529883D1 - 200	SERPENTINE BELT-28.4	67.76	67.76
1.00	Parts	197-6291 - 200	SERPENTINE BELT-EFF	83.50	83.50
16.00	Parts	CH215-9463 - 200	GASKET-125MM DIA X .	3.79	60.64
1.00	Parts	501153D1 - 200	AIR FILTER	36.55	36.55
2.00	Parts	CH148-8395 - 200	HEX SCKT HD PLUG-1/2	2.02	4.04
1.00	Parts	556396D1 - 200	HUB CAP-MIDROLLER	35.70	35.70
1.00	Parts	1921563	Idler As.	126.14	126.14
1.00	Parts	1900643	Tightener-Be	282.89	282.89
1.00	Parts	1731498	Pulley As-Id	160.72	160.72
1.00	Parts	221-1233 - 200	IDLER PULLEY	183.00	183.00
2.00	Parts	534039D1 - 200	FILTER ELEMENT	103.65	207.30
1.00	Parts	501771D1 - 200	ELEMENT	17.95	17.95
2.00	Parts	79034867 - 200	OIL-SAE 50 1G	46.99	93.98
	Labor		Labor		2,969.34
11.50	Misc	CD6	CAT DEO-ULS 15W40 GAL	22.33	256.80
55.00	Misc	CT5	CAT MTO OIL GAL	19.14	1,052.70

Invoice	Date	Call Number	Location	Page
SI000358737	7/18/2023	SC00334289	New Hampton	4 / 14

### SC00334289-004 Perform Maintenance On - Machine

Parts	1,827.00
Labor	2,969.34
Misc	1,309.50
Segment Subtotal:	6,105.84

### SC00334289-005 Replace - Ladder/Step

Customer complaint: Replace bent ladder steps and install pivoting steps actuator.

Resultant damage: Bent steps.

Cause of failure: Tractor must of hit something to bent the steps.

Repair process comments: Removed and replaced the ladder steps. Installed the pivoting steps actuator. Tied up excess wiring. Ran machine. Verified correct machine operation. All fasteners/hardware was torqued to spec. Task complete.

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033
Quantity	Type	Part Number	Description	Unit Price	Amount
1.00	Parts	502645D1 - 200	STEP	670.00	670.00
1.00	Parts	529153D1 - 200	ACTUATOR-12V DC, 200	982.00	982.00
2.00	Parts	529155D1 - 200	CLEVIS PIN-12 X 35	16.20	32.40
2.00	Parts	599179D1 - 200	LOCKING RING-28.55MM	0.51	1.02
	Labor		Labor		

### SC00334289-005 Replace - Ladder/Step

Parts	1,685.42
Labor	612.00
Misc	
Segment Subtotal:	2,297.42

<b>Invoice</b>	<b>Date</b>	<b>Call Number</b>	<b>Location</b>	<b>Page</b>
SI000358737	7/18/2023	SC00334289	New Hampton	5 / 14

### SC00334289-006 Repair - Cab

Customer complaint: Replace all broken cab panels. Replace worn cab window/door shocks. Replaced window latch and handle. Replace broken cab shades. Replace wiper blades. Replace door seal.

Resultant damage: Everything was broke or worn.

Cause of failure: Everything was broke or worn.

Repair process comments: Replaced all broken cab panels, cab window/door shocks, window latch and handle, broken cab shades, wiper blades, and door seal. Ran machine. Verified no leaks and correct operation. Task complete.

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033

  

Quantity	Type	Part Number	Description	Unit Price	Amount
4.00	Parts	CH9X-2043 - 200	TORX HEAD SCREW-M6 X	1.23	4.92
4.00	Parts	400300X1 - 200	HEX NUT-M6X1.0	2.14	8.56
1.00	Parts	169-6328 - 200	WINDOW HANDLE	347.00	347.00
2.00	Parts	CH172-6862 - 200	GAS SPRING	116.00	232.00
1.00	Parts	CH170-1445 - 200	WINDOW LATCH	60.27	60.27
6.00	Parts	CH9X-2045 - 200	TORX HEAD SCREW-M6 X	1.45	8.70
1.00	Parts	501688D1 - 200	WIPER BLADE	71.69	71.69
4.00	Parts	547711D1 - 200	BALL STUD-M8 X 1.25	9.15	36.60
1.00	Parts	CH134-1935 - 200	WIPER BLADE	57.72	57.72
1.00	Parts	79035297 - 200	SEAL-550 CM ROLL	103.99	103.99
1.00	Parts	501026D1 - 200	GAS SPRING	44.95	44.95
2.00	Parts	536250D1 - 200	RETAINING CLIP-11MM	3.85	7.70
1.00	Parts	521079D1 - 200	SUN VISOR	70.50	70.50
1.00	Parts	530315D1 - 200	SUN SHIELD-LH	83.32	83.32
1.00	Parts	513515D1 - 200	COVER	260.00	260.00
1.00	Parts	513514D1 - 200	CONSOLE	121.00	121.00
2.00	Parts	400084X1 - 200	U-NUT-M4 X 0.7	2.89	5.78
	Labor		Labor		973.00
1.00	Misc	OWM - LABOR-Z	window latch repair	125.00	125.00

**SC00334289-006 Repair - Cab**

Parts	1,524.70
Labor	973.00
Misc	125.00
<b>Segment Subtotal:</b>	<b>2,622.70</b>

Invoice	Date	Call Number	Location	Page
SI000358737	7/18/2023	SC00334289	New Hampton	6 / 14

#### SC00334289-007 Clean & Paint - Machine

Customer complaint: Clean and touch up paint machine.

Resultant damage: NA

Cause of failure: NA

Repair process comments: Cleaned machine. Deep cleaned cab when most of cab parts were removed. Touch up painted machine. Task complete.

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033
Quantity	Type	Part Number	Description	Unit Price	Amount
3.00	Parts	79036678 - 200	PAINT-GLS BL 13A	10.25	30.75
1.00	Parts	79033129 - 200	PAINT-NEWCH GRYA	10.25	10.25
	Labor		Labor		1,689.00

#### SC00334289-007 Clean & Paint - Machine

Parts	41.00
Labor	1,689.00
Misc	
Segment Subtotal:	1,730.00

#### SC00334289-009 Troubleshoot - Decelerator/Accelerator

Customer complaint: Decel pedal potentiometer is inop. Install new decel pedal potentiometer to see if it makes it operable. If it does not, put old decel pedal potentiometer back on and button everything back up.

Repair process comments: Installed new decel pedal potentiometer. New potentiometer did not fix the problem. Put old one back on and button everything back up. Task complete.

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033
Quantity	Type	Part Number	Description	Unit Price	Amount

#### SC00334289-009 Troubleshoot - Decelerator/Accelerator

Parts	
Labor	
Misc	
Segment Subtotal:	0.00

Invoice	Date	Call Number	Location	Page
SI000358737	7/18/2023	SC00334289	New Hampton	7 / 14

### SC00334289-011 Repair - Steering Column

Customer complaint: Replace leaking steering column shock, broken steering column shock linkage, broken steering column panels, and inop dash cluster.

Resultant damage: Broken steering column shock, linkage, panels, and dash cluster.

Cause of failure: Broken linkage, worn parts.

Repair process comments: Replaced broken steering column panels, shock, linkage, and dash. Ran machine. Verified correct operation and adjustment. All fasteners/hardware was torqued to spec. Task complete.

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033
Quantity	Type	Part Number	Description	Unit Price	Amount
1.00	Parts	553223D2 - 200	CONTROL PANEL	384.55	384.55
1.00	Parts	CH162-8550 - 200	GAS STRUT KIT	182.89	182.89
1.00	Parts	CH191-3701 - 200	SERVICE KIT	740.70	740.70
1.00	Parts	574105D1 - 200	CONSOLE	137.00	137.00
1.00	Parts	574115D1 - 200	CONSOLE	137.00	137.00
1.00	Parts	513555D1 - 200	COVER	8.76	8.76
	Labor		Labor		

SC00334289-011 Repair - Steering Column

Parts	1,590.90
Labor	765.00
Misc	
<b>Segment Subtotal:</b>	<b>2,355.90</b>

Invoice  
SI000358737

Date  
7/18/2023

Call Number  
SC00334289

Location  
New Hampton

Page  
8 / 14

### SC00334289-012 Repair - Hood

Customer complaint: Replace broken hood panels, hood seal, and hood struts. Remove previous dealers decals from machine.

Resultant damage: Broken hood panels, seal, and struts.

Cause of failure: Wear.

Repair process comments: Removed hood decals. Replaced hood struts, broken hood panels, and hood seal. Ran machine. Verified correct machine operation. All fasteners/hardware was torqued to spec. Task complete.

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033
Quantity	Type	Part Number	Description	Unit Price	Amount
1.00	Parts	190-5942 - 200	LID	227.00	227.00
1.00	Parts	208-9495 - 200	BRACKET	51.40	51.40
1.00	Parts	CH5P-3602 - 200	SEAL-50' ROLL	2.04	2.04
1.00	Parts	196-6954 - 200	PANEL	574.00	574.00
2.00	Parts	531232D1 - 200	GAS SPRING	69.99	139.98
1.00	Parts	501148D1 - 200	SEAL	66.70	66.70
1.00	Parts	196-6944 - 200	LEFT HAND PANEL	421.00	421.00
1.00	Parts	500738D2 - 200	HOOD DECAL, RH	42.98	42.98
1.00	Parts	500737D2 - 200	HOOD DECAL, LH	42.98	42.98
2.00	Parts	530417D1 - 200	DECAL	6.89	13.78
1.00	Parts	196-6946 - 200	RIGHT HAND PANEL	440.00	440.00
	Labor		Labor		
1.00	Misc	OWM - LABOR-Z	sticker install	326.00	326.00

SC00334289-012 Repair - Hood

Parts	2,021.86
Labor	612.00
Misc	326.00
Segment Subtotal:	2,959.86



Invoice	Date	Call Number	Location	Page
SI000358737	7/18/2023	SC00334289	New Hampton	9 / 14

### SC00334289-013 Repair - Undercarriage

Customer complaint: Replace worn torque rod, and worn bogie wheel. Install driver scraper. Diagnose and fix track tension codes, and fuel sender code.

Resultant damage: Worn parts and cut wires.

Cause of failure: Worn parts and cut wires.

Repair process comments: Replaced worn torque rod. Replaced worn bogie wheel. Removed driver wheel. Installed driver wheel scraper. Installed driver. Started diagnosing track tension codes. Found that the track tension sensors were both not getting power. Narrowed it down to be part of the cab harness, not the chassis harness. Took apart cab floor to get access to cab harness. Found the power wire for that circuit to be cut and had about 3-4 inches cut out of it. Spliced in new wire with good connections. Ran machine. Verified code went away and both sensors were reading good. Reinstalled cab floor. Machine had code for the fuel sender sensor. The fuel gauge wouldn't work because of this. Found the fuel sensor on top of the fuel sender to be broke off causing that circuit to be open. Removed old sensor. Had to extract out one of the mounting screws has it broke off during removal. Was able to mount new screws in the sender. Installed new sensor. Ran machine. Verified code went away and fuel gauge was now working. Tensioned tracks. Verified correct machine operation for everything. All fasteners/hardware was torqued to spec. Task complete

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033

Quantity	Type	Part Number	Description	Unit Price	Amount
4.00	Parts	400032X1 - 200	BOLT-M20X2.5X100 HHD	9.04	36.16
4.00	Parts	400080X1 - 200	FLAT WASHER-X22-35X3	1.39	5.56
1.00	Parts	183-8600 - 200	ROD	418.99	418.99
4.00	Parts	CH213-1827 - 200	SPACER-22ID X 35OD X	49.95	199.80
1.00	Parts	551592D1 - 200	DEFLECTOR-ASM-MT800	462.00	462.00
1.00	Parts	CH204-7458 - 200	SENSOR KIT	126.00	126.00
	Labor		Labor		

**SC00334289-013 Repair - Undercarriage**

Parts	1,248.51
Labor	1,224.00
Misc	
<b>Segment Subtotal:</b>	<b>2,472.51</b>

<b>Invoice</b>	<b>Date</b>	<b>Call Number</b>	<b>Location</b>	<b>Page</b>
SI000358737	7/18/2023	SC00334289	New Hampton	10 / 14

### SC00334289-014 Repair - Cooling Package

Customer complaint: Replace fan shroud. Diagnose coolant leak. Diagnose and fix inop windshield washer fluid system.  
 Resultant damage: Broken coolant hose clamp. Broken windshield washer fluid reservoir. Broken fan shroud.  
 Cause of failure: Broken coolant hose clamp. Broken windshield washer fluid reservoir. Broken fan shroud.  
 Repair process comments: Replaced coolant hose clamp. Replaced fan shroud. Replaced windshield washer fluid. Ran machine. Verified correct operation for everything on this segment, and no leaks. All fasteners/hardware was torqued to spec. Task complete.

<b>Customer PO</b>	<b>Customer EQ</b>	<b>Model</b>	<b>Serial Number</b>	<b>Equipment ID</b>	<b>Segment SMU</b>
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033

Quantity	Type	Part Number	Description	Unit Price	Amount
1.00	Parts	502586D1 - 200	SHROUD	669.00	669.00
1.00	Parts	400126X1 - 200	HOSE CLAMP-57-79MM R	18.79	18.79
1.00	Parts	CH208-9635 - 200	RESERVOIR	196.00	196.00
1.00	Parts	PRIM92006 - 148	-20 Washer Fluid	3.18	3.18
	Labor		Labor		

**SC00334289-014 Repair - Cooling Package**

Parts	886.97
Labor	612.00
Misc	
<b>Segment Subtotal:</b>	<b>1,498.97</b>

Invoice	Date	Call Number	Location	Page
SI000358737	7/18/2023	SC00334289	New Hampton	11 / 14

### SC00334289-015 Troubleshoot - Parking Brake

Customer complaint: Diagnose and fix park brake.

Resultant damage: Inoperable park brake switch.

Cause of failure: Cut wires.

Repair process comments: When replacing the transmission joystick, I had found wires to be cut to the park brake on the transmission joystick. Installed new transmission joystick assembly including the park brake switch. Ran machine. Verified no park brake code. Verified machines park brake would hold machine on an incline. Verified correct machine operation. All fasteners/hardware was torqued to spec. Task complete.

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033

Quantity	Type	Part Number	Description	Unit Price	Amount
	Labor		Labor		284.50

**SC00334289-015 Troubleshoot - Parking Brake**

Parts	
Labor	284.50
Misc	
<b>Segment Subtotal:</b>	<b>284.50</b>

### SC00334289-018 Troubleshoot - Mirror

Customer complaint: Diagnose and fix mirrors.

Resultant damage: Broken mirrors.

Cause of failure: Bad mirrors.

Repair process comments: Removed connector to mirrors. Both mirrors were getting power. Mirrors would only move a little bit. Removed and replaced mirrors. Ran machine. Verified correct mirror operation. All fasteners/hardware was torqued to spec. Task complete.

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033

Quantity	Type	Part Number	Description	Unit Price	Amount
2.00	Parts	206-0579 - 200	SIDE MIRROR-214MM X	256.00	512.00
	Labor		Labor		

**SC00334289-018 Troubleshoot - Mirror**

Parts	512.00
Labor	306.00
Misc	
<b>Segment Subtotal:</b>	<b>818.00</b>

<b>Invoice</b>	<b>Date</b>	<b>Call Number</b>	<b>Location</b>	<b>Page</b>
SI000358737	7/18/2023	SC00334289	New Hampton	12 / 14

# SC00334289-019 Troubleshoot - Light(S)

Customer complaint: Diagnose and fix inop extremity arm lights and work lights.

Resultant damage: Lights were broke or heavily corroded.

Cause of failure: Lights were broke or heavily corroded.

Repair process comments: All lights had 12 volts provided to light connectors. Replaced inop work lights. Took apart extremity arm lights. Found all bulbs to be broke, and the light sockets/wiring to be full of corrosion. Replaced extremity arm lights. Ran machine. Verified correct operation. All fasteners/hardware was torqued to spec. Task complete.

<b>Customer PO</b>	<b>Customer EQ</b>	<b>Model</b>	<b>Serial Number</b>	<b>Equipment ID</b>	<b>Segment SMU</b>
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033

Quantity	Type	Part Number	Description	Unit Price	Amount
2.00	Parts	4280589M1 - 200	WORKLIGHT	95.01	190.02
2.00	Parts	155-0027 - 200	TURN SIGNAL LAMP	78.68	157.36
100.00	Parts	6K0806	Strap-Cable	0.43	43.00
	Labor		Labor		

**SC00334289-019 Troubleshoot - Light(S)**

Parts	390.38
Labor	306.00
Misc	
<b>Segment Subtotal:</b>	<b>696.38</b>

Invoice	Date	Call Number	Location	Page
SI000358737	7/18/2023	SC00334289	New Hampton	13 / 14

### SC00334289-020 Repair - Seat Assembly

Customer complaint: Replaced broken seat belt. Diagnose and fix inop seat air compressor. Replace transmission joystick. Resultant damage: Broken seat belt, broken transmission joystick. Seat air compressor inop.

Cause of failure: Loose seat connector connection. Transmission joystick had a broken joystick assembly and missing hardware.

Repair process comments: Removed armrest to replace transmission joystick. Took apart armrest. Replaced transmission joystick. Put armrest back together. Removed seat. Bench tested seat. Seat tested fine. Installed seat. Installed armrest. Replaced broken seat belt. Checked seat connector. Found a loose connection in that seat connector. Connected that connector to the seat. Ran machine. Verified correct operation for everything on this segment. Verified no codes. All fasteners/hardware was torqued to spec. Task complete.

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033
Quantity	Type	Part Number	Description	Unit Price	Amount
1.00	Parts	185-2151 - 200	SEAT BELT	83.73	83.73
1.00	Parts	508318D1 - 200	JOYSTICK	1,357.00	1,357.00
2.00	Parts	400073X1 - 200	SOCKET HEAD BOLT-M3	4.19	8.38
1.00	Parts	3009534X1 - 200	PAN HEAD SCREW-M4 X	2.25	2.25
1.00	Parts	400836X1 - 200	MACHINE SCREW-M5 X 0	0.79	0.79
1.00	Parts	403196X1 - 200	P-CLAMP-1/4"	0.20	0.20
4.00	Parts	521651D1 - 200	MACHINE SCREW-M6 X .	0.30	1.20
	Labor		Labor		1,967.50

**SC00334289-020 Repair - Seat Assembly**

Parts	1,453.55
Labor	1,967.50
Misc	
<b>Segment Subtotal:</b>	<b>3,421.05</b>

Invoice	Date	Call Number	Location	Page
SI000358737	7/18/2023	SC00334289	New Hampton	14 / 14

### SC00334289-021 Repair - Couplers, Hoses & Valves

Customer complaint: Replace remote valve stack.

Resultant damage: Broken and leaking valve stack.

Cause of failure: Broken and leaking valve stack.

Repair process comments: Unhooked husco valves. Unhooked hydraulic lines. Removed and replaced remote valve stack.

Installed husco valves. Installed hydraulic lines. Ran machine. Verified correct operation and no leaks. All fasteners/hardware was torqued to spec. Task complete.

Customer PO	Customer EQ	Model	Serial Number	Equipment ID	Segment SMU
		MT865C	AGCC0865VNWKG1001	EQ0072504	8,033
Quantity	Type	Part Number	Description	Unit Price	Amount
	Labor		Labor		994.50

**SC00334289-021    Repair - Couplers, Hoses & Valves**

Parts	
Labor	994.50
Misc	
<b>Segment Subtotal:</b>	<b>994.50</b>