

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

SAME AS BELOW

Invoice To:

BRYCE RICKLEFS INC
 12536 BUFFALO RD
 ANAMOSA IA 52205

Branch MONTICELLO, IA *REPRINT*		
Date 02/28/19	Time 04:07:27 (B)	Page 01
Account No. RICKL002	Phone No. 3194624435	Invoice No. W20819
Ship Via		Purchase Order S680 RICKLEFS
		Salesperson 056

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C024463	S680 corn combine		X 1H0S680SHD0757578	10/05/14	
	S680	1240		10/05/18	1750 P

SEGMENT# 1 C KREMR /COMBINSWPWIN 12/04/18 12/04/18

Inspection Combine (Booked Nov1 to 1Mar) \$300

Complete inspection checklist, review with customer.

RS10	oil test	4	18.43	73.72
			PARTS	73.72
			LABOR	300.00
10600005		SEGMENT TOTAL==>		373.72

SEGMENT# 2 C KREMR NA 12/04/18 12/26/18

WORK FROM INSPECTION

REPLACED FH. DRIVE CHAIN, GUIDES, TOP AND BOTTOM FH. DRIVE
 SPROCKETS, REMOVED LHS. FH. LIFT CYLINDER AND INSTALLED NEW
 SEAL KIT, LOOSENED FH. CHAIN, REMOVED CONNECTOR LINKS, WELDED
 DENT IN DRUM AND GROUND SMOOTH, ADJUSTED CHAIN, DRAINED OIL
 OUT OF REVERSER, IT WAS BURNT AND HAD METAL SHAVINGS, REMOVED
 REVERSER AND REMOVED COVER, GEARS WERE FLAKING OFF, INSTALLED
 NEW REVERSER AND FILLED WITH OIL, INSTALLED DRIVE
 SHEAVES, REPLACED LOWER FH. DRIVE
 BELT, REMOVED REEL PUMP AND REPLACED BEARINGS, PULLEY AND
 HUB, REPLACED UNLOADING AUGER DRIVE BELTS AND ADJUSTED BELT
 GUIDE, REMOVED CHAFFER AND REPLACED 6 LOUVER
 SECTIONS, ADJUSTED CLEAN GRAIN ELEVATOR PADDLE CHAIN, REMOVED
 HALF LINK FROM TAILINGS ELEVATOR PADDLE CHAIN AND ADJUSTED
 CHAIN, CHANGED ENGINE OIL AND FILTER, HYDRAULIC OIL AND
 FILTER, ENGINE GEARCASE OIL AND FILTERS, ENGINE AIR
 FILTER, CAB AIR FILTERS, PLASTIC HOUSING FOR CAB FILTER HAD
 TAB BROKE OFF AND WAS NOT SEALING TIGHT, REPLACED
 HOUSING, REPLACED HORIZONTAL UNLOAD AUGERS, GRAIN SAVER DOOR
 AND UNLOAD AUGER BOOT, FIXED CAB LADDER LATCH, TUBE WAS WORN

CONTINUED ON PAGE 02



JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

SAME AS BELOW

Invoice To:

BRYCE RICKLEFS INC
 12536 BUFFALO RD
 ANAMOSA IA 52205

Branch			
MONTICELLO, IA			
Date	Time	Page	
02/28/19	04:07:27 (B)	02	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W20819	
Ship Via		Purchase Order	
		S680 RICKLEFS	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C024463	S680 corn combine		X 1H0S680SHD0757578	10/05/14	
	S680	1240		10/05/18	1750 P

AND NOT SQUARE,GROUND OFF TUBE AND USED WASHERS
 SPACERS,INSTALLED NEW BOLTS AND ADJUSTED,REPLACED CLEANING
 SHOE ARMS, BOLTS AND NUTS WHILE CHAFFER FRAME WAS OUT TO DO
 PIP. REPLACED IDLER AND BELT FOR VACUUM FAN,REPLACED
 RUBBER SEAL ON STONE TRAP,CHAFFER PRE CLEANER HAD PLATE
 MISSING FROM IT,WELDED IN PLATE AND WELDED ON UNDER SIDE OF
 OTHER PLATES STILL IN PRE CLEANER

AHC16954	Hyd Cylinder Kit	1	84.45	84.45
	Hydraulic Cylinder Kit			
AH128449	HYDRAULIC	1	52.40	52.40
	Hydraulic Filter			
AH166639	CHAIN LINK	1	6.78	6.78
AH170129	LOUVER	5	23.17	115.85
AH201038	BALL BEARI	1	133.66	133.66
AH201531	BEARING	1	49.58	49.58
AH203021	AUGER	1	1377.27	1377.27
AH212097	HYDRAULIC	1 M	49.88	49.88
	Hydraulic Cylinder Kit			
AH219844	ARM	1	207.81	207.81
AH219846	ARM	1	198.99	198.99
AH220398	Arm	6	68.98	413.88
AH221973	DOOR	1	94.53	94.53
AH232566	LINK CHAIN	1	123.60	123.60
AH232851	Drive Sprocket	1 M	242.43	242.43
AH233198	Belt Set	1	166.88	166.88
AH80335	WEATHERSTR	55	.45	24.75
AN207368	HYDRAULIC FI	1	78.56	78.56
	Hydraulic Filter			
AXE12964	Hydraulic Filte	1	65.23	65.23
	Hydraulic Filter			

CONTINUED ON PAGE 03



JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

SAME AS BELOW

Invoice To:

BRYCE RICKLEFS INC
 12536 BUFFALO RD
 ANAMOSA IA 52205

Branch			
MONTICELLO, IA			
Date	Time	Page	
02/28/19	04:07:27 (B)	03	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W20819	
Ship Via		Purchase Order	
		S680 RICKLEFS	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS	
C024463	S680 corn combine		X 1H0S680SHD0757578	10/05/14		
	S680	1240		10/05/18	1750 P	
AXE16294	Arm		2 M	150.06		300.12
AXE21035	Seal		1 N	65.93		65.93
AXE21036	Seal		1 N	65.93		65.93
AXE24984	Idler		RETAIL	126.65		
			1	126.64		126.64
AXE56290	Auger		1	1594.69		1594.69
BLACK	10.9 METRIC		23	.48		11.04
DE31465	Gear Case		1 N	6047.83		6047.83
E59406	FLANGE NUT		1	.78		.78
HXE11090	Filter		1	165.93		165.93
HXE117080	Plug		1 N	1.44		1.44
HXE16541	Isolator		1 M	19.85		19.85
HXE22040	Shaft Key		1 N	5.33		5.33
HXE38073	V-Belt		1	19.01		19.01
HXE71069	Boot		1	187.88		187.88
H113751	PAD		1 N	5.92		5.92
H135891	LOCK NUT		4	1.14		4.56
H154928	BOLT		8	4.67		37.36
H172475	GUIDE		1	19.60		19.60
H217334	SPRING		1	6.54		6.54
H219634	Chain Sprocket		1 N	70.39		70.39
H223849	RING		1	3.39		3.39
H224043	Pulley		1 M	446.53		446.53
H227582	Bolt		4	8.27		33.08
H229019	V-BELT		1	356.61		356.61
H229359	PIN FASTENER		RETAIL	8.88		
			1	8.87		8.87
H231095	Bolt		RETAIL	8.61		
			2	8.60		17.20
H233154	Hub		1 M	143.54		143.54

CONTINUED ON PAGE 04



JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

SAME AS BELOW

Invoice To:

BRYCE RICKLEFS INC
 12536 BUFFALO RD
 ANAMOSA IA 52205

Branch			
MONTICELLO, IA			
Date	Time	Page	
02/28/19	04:07:27 (B)	04	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W20819	
Ship Via		Purchase Order	
		S680 RICKLEFS	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C024463	S680 corn combine		X 1H0S680SHD0757578	10/05/14	
	S680	1240		10/05/18	1750 P
H234587	GUIDE		RETAIL	30.31	
			1	30.30	30.30
H235880	Bolt		2	8.48	16.96
H84026	HOOK		2	.39	.78
JD7797	LUBRICATIO		1	.54	.54
	Lubrication Fitting				
JD9373	BALL BEARI		2	32.13	64.26
L201887	Box		1 N	48.27	48.27
L214634	Filter		1	18.40	18.40
N231749	WASHER		4	2.17	8.68
N309233	O-RING		1	7.37	7.37
RE284091	AIR FILTER		1	58.59	58.59
RE533910	FUEL FILTER		1	117.17	117.17
RE539465	FILTER ELE		1	94.47	94.47
RE572785	Oil Filter		1	48.56	48.56
R101042	O-RING		1	3.42	3.42
R44302	TIE BAND		11	.09	.99
R78065	SOCKET CON		2	1.28	2.56
	Elec. Connector Terminal				
TY26408	80W90 SYNTHETIC		RETAIL	25.83	
			6	20.00	120.00
TY26625B	HY-Gard		108	3.02	326.16
TY26686B	Plus-50 II Oil		42	3.57	149.94
TY6296	80W90 QT		RETAIL	8.76	
			2	6.80	13.60
T14931	SNAP RING		1	6.60	6.60
T77858	O-RING		2	1.73	3.46
03M7218	BOLT		2	2.37	4.74
11M7012	COTTER PIN		1	.24	.24
11M7032	COTTER PIN		1	.44	.44

CONTINUED ON PAGE 05



JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

SAME AS BELOW

Invoice To:

BRYCE RICKLEFS INC
 12536 BUFFALO RD
 ANAMOSA IA 52205

Branch			
MONTICELLO, IA			
Date	Time	Page	
02/28/19	04:07:27 (B)	05	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W20819	
Ship Via		Purchase Order	
		S680 RICKLEFS	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS	
C024463	S680 corn combine		X 1H0S680SHD0757578	10/05/14		
	S680	1240		10/05/18	1750 P	
11M7099	COTTER PIN		3 M	.13		.39
14M7291	FLANGE NUT		12	2.33		27.96
14M7400	LOCK NUT		2	1.24		2.48
19M7820	SCREW		6	4.65		27.90
19M7823	Screw		1	6.73		6.73
19M7826	SCREW		1	4.76		4.76
19M8486	CAP SCREW		2	9.30		18.60
24H1162	WASHER		3	.71		2.13
24H1850	WASHER		4	1.52		6.08
24M7024	WASHER		1	1.02		1.02
24M7106	WASHER		RETAIL	.42		
			1	.41		.41
				PARTS		14497.48
				LABOR		8186.39
10600005			SEGMENT TOTAL==>			22683.87

SEGMENT# 3 C KREMR /COMBINEBLO 12/04/18 11/30/18

Blow Off Combine \$150

Run combine full throttle with sieve and chaffer in max open position.

Remove the following, tag, and place in designated storage area/box:

- Safety shields
- Rotor covers
- Left Hand side hose/frame cover

Open rock trap.

Open grain tank covers.

Open after-treatment shields, if equipped.

Remove/blow out debris from:

- Rock trap

CONTINUED ON PAGE 06



JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516


 ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

SAME AS BELOW

Invoice To:

 BRYCE RICKLEFS INC
 12536 BUFFALO RD
 ANAMOSA IA 52205

Branch		MONTICELLO, IA	
Date	Time	Page	
02/28/19	04:07:27 (B)	06	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W20819	
Ship Via		Purchase Order	
		S680 RICKLEFS	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C024463	S680 corn combine		X 1H0S680SHD0757578	10/05/14	
	S680	1240		10/05/18	1750 P

--Areas under rotor
 --Shoe augers
 --Both primary counter shaft gear case tubes
 --Engine, engine platform, radiator, and cooler
 --Behind engine, above rotor
 --After-treatment
 --Grain tank
 --Overall exterior surfaces

	LABOR	150.00
10600005	SEGMENT TOTAL==>	150.00

SEGMENT# 4 C SCHEM /COMBINRS3FU 12/04/18 01/25/19

Wash Combine Full Interior and Exterior \$450

Wash Interior Surfaces

--Engine Platform
 --Concave Area
 --Shoe Area
 --Shoe Auger Area

Wash External Shell Surfaces

	LABOR	450.00
10600005	SEGMENT TOTAL==>	450.00

SEGMENT# 5 C SCHEM /DISCOUNTM-U 12/04/18

Discounts / Savings applied to this work order:

-Parts and Labor Discount-credited in Work Order Totals
 -Free JD Polo or Sweatshirt, please let Carrie know the size you wanted ordered.
 -John Deere Financial No Payment / No Interest plan.
 -Waived PWRWASH/CLEANING Fee-credited in Work Order Totals
 COMBINE WASH FULL INTERIOR AND EXTERIOR CREDIT (-\$450.00)

CONTINUED ON PAGE 07

**JOHN DEERE**

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

SAME AS BELOW

Invoice To:

BRYCE RICKLEFS INC
 12536 BUFFALO RD
 ANAMOSA IA 52205

Branch			
MONTICELLO, IA			
Date	Time	Page	
02/28/19	04:07:27 (B)	07	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W20819	
Ship Via		Purchase Order	
		S680 RICKLEFS	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS	
C024463	S680 corn combine	X	1H0S680SHD0757578	10/05/14		
	S680	1240		10/05/18	1750 P	
				LABOR		450.00-
10600005				SEGMENT TOTAL==>		450.00-

SEGMENT# 6 C SCHEM /AG WTY DESC 12/04/18

AG PARTS WARRANTY TERMS -AG EQUIP, 5000 SERIES TRACTORS+

This repair includes 12 months/unlimited hours coverage for
 both PARTS and LABOR on the John Deere OEM parts listed on
 this work order. (Note: Battery, Software, and Reman AC
 components have alternative coverage)

***** WORK ORDER TOTALS *****

PARTS	14571.20
LABOR	8636.39
CLEANING/PWRWAS	10.00
Diagnostic Tech	10.00
HAZ MTL	20.00
SRVC ACCESSORY	25.00
TOURCH/WELDING	15.00
DISCOUNT	1160.41-
SUB TOTAL==>	22127.18
7% IOWA TAX- TAX 1	617.60
TOTAL FARMPLAN	22744.78

154663 1239641428




JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516

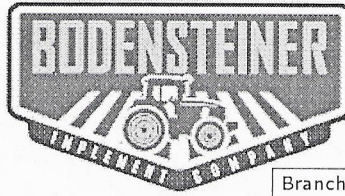

ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

S680 RICKLEFS

Invoice To:

JOHN DEERE WARRANTY

.
 .
 . IA .

Branch		MONTICELLO, IA *REPRINT*	
Date	Time	Page	
02/28/19	21:17:13 (B)	01	
Account No.	Phone No.	Invoice No.	
WARR0001		W20820	
Ship Via		Purchase Order	
		S680 RICKLEFS	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#

C024463

S680 corn combine

HRS PIN/EIN

1240

WARRANTY DATE

10/05/14

HRS

1750 P

SEGMENT# 1 C KREMR /17HX527A 12/04/18 12/05/18

Complete PIP 17HX527A

7.00 HRS

CORRECTION:

REMOVE AND INSTALL CHAFFER FRAME

ADDITIONAL DESCRIPTION:

MPH20178

7.00

Complete PIP per instructions

MPH20178

Engine Kit

RETAIL

181.80

LABOR

683.59

10500005

SEGMENT# 2 C KREMR /17HX527B 12/04/18 12/07/18

Complete PIP 17HX527B

10.00 HRS

MPH20140

10 HRS

Complete Per instructions

MPH20140

PIP KIT

RETAIL

2034.77

LABOR

934.26

10500005

SEGMENT# 3 C KREMR /17HX527D 12/04/18 12/12/18

Complete PIP 17HX527D-Replace Time 4 Deflector &/or Channel

.50 HRS

.50

AXE17210

CONTINUED ON PAGE 02




JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516

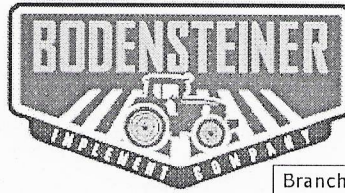

ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

S680 RICKLEFS

Invoice To:

JOHN DEERE WARRANTY

.
 .
 . IA .

Branch		MONTICELLO, IA	
Date	Time	Page	
02/28/19	21:17:13 (B)	02	
Account No.	Phone No.	Invoice No.	
WARR0001		W20820	
Ship Via		Purchase Order	
		S680 RICKLEFS	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#

C024463

S680 corn combine

HRS PIN/EIN

X 1H0S680SHD0757578

WARRANTY DATE

10/05/14

HRS

S680

1240

10/05/18

1750 P

Additional time for replacing:

Deflector AXE17210

Channel AH164851

0.50 h (10.0 h if MPH20140 is not needed)

AXE17210

Deflector

RETAIL

846.69

RED

8.8 METRIC

RETAIL

.36

LABOR

55.50

10500005

***** WORK ORDER TOTALS *****

INTERNAL

CUSTOMER

LABOR

1673.35



JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

S680 RICKLEFS

Invoice To:

BRYCE RICKLEFS INC
 12536 BUFFALO RD
 ANAMOSA IA 52205

Branch MONTICELLO, IA *REPRINT*		
Date 03/29/18	Time 21:18:22 (B)	Page 01
Account No. RICKL002	Phone No. 3194624435	Invoice No. W17917
Ship Via		Purchase Order S680 RICKLEFS
		Salesperson 056

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C024463	S680 corn combine	1553	1H0S680SHD0757578	10/05/14	
	S680	1180		10/05/18	1750 P

SEGMENT# 1 C LAHRD /COMBINSPWIN 12/26/17 01/02/18

Inspection Combine (Booked prior to 1March) \$300

CORRECTION:

DO INSPECTION GO OVER WITH BRYCE ON THE PHONE

1553 1180

ADDITIONAL DESCRIPTION:

Units in storage: contact customer to let them know
 starting inspection and make arrangements to review
 inspection results.

Complete Fluid Analysis to review with customer*** (Sample
 Kits: Additional charge).

Verify AMS / Vehicle software updates to review with
 Customer.

Print Service ADVISOR Load Profile information to review
 with customer.

Print recommended maintenance to review with customer.

Complete inspection checklist to review with customer.

Provide customer estimate on when agreed upon repairs will
 be complete and make arrangements on returning unit to
 customer.

RS10	oil test	4	PARTS	73.72
			LABOR	300.00
10600005			SEGMENT TOTAL==>	373.72

SEGMENT# 2 C LAHRD NA 12/26/17 01/23/18

WORK FROM INSPECTION

CORRECTION:

REPLACED LOWER GUIDE ON FH CHAIN. SWITCHED COUPLER ON FH

CONTINUED ON PAGE 02



JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

S680 RICKLEFS

Invoice To:

BRYCE RICKLEFS INC
 12536 BUFFALO RD
 ANAMOSA IA 52205

Branch			
MONTICELLO, IA			
Date	Time	Page	
03/29/18	21:18:22 (B)	02	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W17917	
Ship Via		Purchase Order	
		S680 RICKLEFS	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C024463	S680 corn combine	1553	1H0S680SHD0757578	10/05/14	
	S680	1180		10/05/18	1750 P
CHAIN AROUND.REPLACED CHAIN ON UNLOAD DRIVE.REMOVED CHOPPER					
GEARCASE,DISASSEMBLED,REPLACES O-RING SEALS,ASSEMBLE,FILL					
WITH GREASE.REPLACED OUTER VAC BLOWER DR BELT.INSTALLED					
NEW CAP ON HYDRA TANK.					
INSTALLED NEW REAR DISCHARGE LIGHT ON LH SIDE.					
AE42998	BALL BEARI		1	42.76	42.76
	Tapered Roller Bearing				
AE73220	Seal Kit		1 N	100.60	100.60
AH131860	SEAL		1	29.40	29.40
AH204389	IDLER		2 O	93.90	187.80
AH207789	FLOODLAMP		1 M	56.16	56.16
AH209363	FILLER CAP		1	27.24	27.24
AH21815	SEAL		RETAIL	15.37	
			1	8.84	8.84
AH233419	Auger		1	915.90	915.90
AN102562	C H GREASE		1	3.81	3.81
AXE15956	Roller Chain		1	327.52	327.52
DE20207	Ball Bearing		1	27.67	27.67
FRTOUT	FREIGHT		2	22.15	44.30
HXE38073	V-Belt		1	19.70	19.70
H172475	GUIDE		1	17.40	17.40
H217963	SEALANT		1	9.70	9.70
JD10384	BEARING		1	31.31	31.31
JD7689	BALL BEARI		1	15.09	15.09
L53869	O-RING		1 M	2.67	2.67
RED	8.8 METRIC		1	.36	.36
R11120	O-RING		1 M	3.87	3.87
TY26101	PARTS CLEANER		RETAIL	4.92	
			1	4.43	4.43

Cleaning Solvent

CONTINUED ON PAGE 03



JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

S680 RICKLEFS

Invoice To:

BRYCE RICKLEFS INC
 12536 BUFFALO RD
 ANAMOSA IA 52205

Branch			
MONTICELLO, IA			
Date	Time	Page	
03/29/18	21:18:22 (B)	03	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W17917	
Ship Via		Purchase Order	
		S680 RICKLEFS	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS	
C024463	S680 corn combine	1553	1H0S680SHD0757578	10/05/14		
	S680	1180		10/05/18	1750 P	
TY26408	80W90 SYNTHETIC	5		23.59		117.95
TY26815	80W90 GAL	1		19.28		19.28
TY6341	GREASE	1		4.19		4.19
T74694	O-Ring	1 M		4.41		4.41
				PARTS		2022.36
				LABOR		3565.95
10600005				SEGMENT TOTAL==>		5588.31

SEGMENT# 3 C THEIC /COMBWASHEXT 12/26/17 03/12/18

Wash Combine Exterior \$200

Verify all interior surfaces have been blown out and clean

Wash external shell surfaces of combine

	LABOR	200.00
10600005	SEGMENT TOTAL==>	200.00

SEGMENT# 4 C THEIC /COMBINEBLO 12/26/17 12/21/17

Blow Off Combine \$150

Run combine full throttle with sieve and chaffer in max open position.

Remove the following, tag, and place in designated storage area/box:

--Safety shields

--Rotor covers

--Left Hand side hose/frame cover

Open rock trap.

Open grain tank covers.

Open after-treatment shields, if equipped.

Remove/blow out debris from:

--Rock trap

--Areas under rotor

CONTINUED ON PAGE 04



JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

S680 RICKLEFS

Invoice To:

BRYCE RICKLEFS INC
 12536 BUFFALO RD
 ANAMOSA IA 52205

Branch			
MONTICELLO, IA			
Date	Time	Page	
03/29/18	21:18:22 (B)	04	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W17917	
Ship Via		Purchase Order	
		S680 RICKLEFS	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C024463	S680 corn combine	1553	1H0S680SHD0757578	10/05/14	
	S680	1180		10/05/18	1750 P

--Shoe augers
 --Both primary counter shaft gear case tubes
 --Engine, engine platform, radiator, and cooler
 --Behind engine, above rotor
 --After-treatment
 --Grain tank
 --Overall exterior surfaces

	LABOR	150.00
10600005	SEGMENT TOTAL==>	150.00

SEGMENT# 5 C THEIC /DISCOUNTM-U 12/26/17

Discounts / Savings applied to this work order:

-Parts and Labor Discount-credited in Work Order Totals
 -Free JD Jacket or Sweatshirt, please let Carrie
 know the size you wanted ordered.

SEGMENT# 6 C SCHEM /WTY AG DESC 12/26/17

AG PARTS WARRANTY TERMS -AG EQUIP/CWP/5000 SERIES TRACTORS+

This Bodensteiner Implement repair includes 12 months /
 unlimited hours coverage for both PARTS and LABOR on the
 John Deere OEM parts listed on this work order. (Note:
 Battery, Software, and Reman AC components have alternative
 coverage)

***** WORK ORDER TOTALS *****

PARTS	2096.08
LABOR	4215.95
Diagnostic Tech	10.00
CONTINUED ON PAGE 05	



JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

S680 RICKLEFS

Invoice To:

BRYCE RICKLEFS INC
 12536 BUFFALO RD
 ANAMOSA IA 52205

Branch			
MONTICELLO, IA			
Date	Time	Page	
03/29/18	21:18:22 (B)	05	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W17917	
Ship Via		Purchase Order	
		S680 RICKLEFS	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS	
C024463	S680 corn combine	1553	1H0S680SHD0757578	10/05/14		
	S680	1180		10/05/18	1750 P	
				SERVICE CALL		50.00
				SRVC ACCESSORY		2.50
				DISCOUNT		313.23 -
				SUB TOTAL==>		6061.30
				7% IOWA TAX- TAX 1		294.54
822731	1239641428			TOTAL FARMPLAN		6355.84

**JOHN DEERE**

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

SAME AS BELOW

Invoice To:

BRYCE RICKLEFS INC
 10782 223RD AVE
 ANAMOSA IA 52205

Branch MONTICELLO, IA *REPRINT*		
Date 10/31/17	Time 21:08:25 (B)	Page 01
Account No. RICKL002	Phone No. 3194624435	Invoice No. W17232
Ship Via	Purchase Order S680	
		Salesperson 056

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C024463	S680 corn combine	1465	1H0S680SHD0757578	10/05/14	
	S680	1123		10/05/18	1750 P

SEGMENT# 1 C LAHRD /WS-COMBINE 10/16/17 10/16/17
 WINTER SPECIAL PERFORMAX COMBINE INSPECTION \$300.00

COMPLAINT:

do inspection

CAUSE:

JUST BOUGHT COMBINE

CORRECTION:

DO INSPECTION, GO OVER WITH BRYCE

ADDITIONAL DESCRIPTION:

PERFORM PERFORMAX SERVICE CHECK OVER -- DO ONLY THE CHECKS
 ON THE FORM -- FILL OUT THE LIST AND MAKE ANY
 RECOMMENDATIONS NEEDED FOR THE UNIT WITH LABOR CHARGES.
 PRINT OUT A PARTS QUOTE AND ATTACH IT TO THE CHECK LIST
 MAKING SURE TO KEEP EACH JOB SEPARATE PARTS AND LABOR. GIVE
 LIST TO SERVICE MANAGER AND HE WILL CALL CUSTOMER. IF YOU
 FIND ANYTHING ELSE WHILE WORKING ON IT CALL CUSTOMER TO
 KEEP HIM INFORMED ON ANY EXTRA CHARGES. PERFORM OIL SCAN
 AND SEND IN.
 10600005

SEGMENT# 2 C LAHRD NA 10/16/17 10/16/17
 WORK FROM INSPECTION

CORRECTION:

REPLACED FH DRIVE CHAIN. REPLACED RING ON DRUM
 ADJUSTER, FREED UP ARM. REPLACED UPPER WEAR GUIDES ON FH
 CHAIN. REMOVE SHOE AUGER DR SHAFT, INSTALL NEW SHAFT, NEW
 BEARINGS. REMOVE 4 SHOE AUGERS, REPLACE BEARINGS BOTH
 ENDS, REINSTALL. INSTALL NEW FEED ACCELERATOR BELT, NEW FRT
 COUNTERSHAFT BELT, NEW REAR COUNTERSHAFT BELT, NEW CLEANING

CONTINUED ON PAGE 02

**JOHN DEERE**

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

SAME AS BELOW

Invoice To:

BRYCE RICKLEFS INC
 10782 223RD AVE
 ANAMOSA IA 52205

Branch			
MONTICELLO, IA			
Date	Time	Page	
10/31/17	21:08:25 (B)	02	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W17232	
Ship Via		Purchase Order	
		S680	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C024463	S680 corn combine	1465	1H0S680SHD0757578	10/05/14	
	S680	1123		10/05/18	1750 P

FAN BELT.INSTALLED 3 WIGS,2 STRIPS ON FEED ACCEL.REPLACED
 BEARING FLANGE ON LN CLEANING FAN,ZERK WAS BROKE
 OFF.INSTALLED NEW UNLOADING BELTS.PULL OUT EVERY OTHER
 WIRE IN CONCAVE.LEVEL. FIXED UP HARNESS BY DISCHARGE
 BELT.R&R POWER CAST
 SPINNERS,INSTALLED NEW PADDLES TOP & BOTTOM
 REPAIRED CRACK IN SIDE SHEET ON DISCHARGE BEATER
 DRIVE.REPLACED SHOE DRIVE BELT.REPLACED SPROCKET AND
 BEARINGS ON TOP CL GR ELE SHAFT,REPLACED SHAFT KEY WAY CUT
 OUT.ADJUST BOTH ELE CHAINS.REPLACED MASS FLOW PAD.GOT
 ROTARY BEACON ON LH SIDE TO WORK.CHANGED ENGINE OIL &FILTER
 ,FUEL FILTERS,AIR FILTERS,CLEANED SEDIMENT BOWL.REPAIRED
 CONNECTOR ON FUEL FILTER WATER SENSOR.CHANGED HYDRA FILTER
 ON PRO DRIVE,AND HYDRA TANK.CHANGED HYDRO FILTER.CHANGED
 BOTH CAB FILTERS.INSTALLED CAMERA ON GRAIN TANK.

ADDITIONAL DESCRIPTION:

SN 1H0S680SHD0757578	1465HRS	1123HRS			
A-GS3C	Electrical Cond	1	73.71		73.71
	Electrical Conductor				
A-VS1C110	TELEVISION C	1	124.19		124.19
	Television Camera				
AH128449	HYDRAULIC	1	51.83		51.83
	Hydraulic Filter				
AH129451	BALL BEARI	1	37.73		37.73
AH129452	ECCENTRIC	1	9.34		9.34
	Eccentric Locking Collar				
AH133191	ECCENTRIC	2	11.93		23.86
	Eccentric Locking Collar				
AH150678	BELT	1	127.39		127.39
AH163056	BEARING HOUS	4	50.28		201.12

CONTINUED ON PAGE 03



JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
CRESCO • DECORAH • DYERSVILLE
MONTICELLO • NEW HAMPTON
OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

SAME AS BELOW

Invoice To:

BRYCE RICKLEFS INC
10782 223RD AVE
ANAMOSA IA 52205

Branch			
MONTICELLO, IA			
Date	Time	Page	
10/31/17	21:08:25 (B)	03	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W17232	
Ship Via		Purchase Order	
		S680	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
C024463	S680 corn combine	1465	1H0S680SHD0757578	10/05/14	
	S680	1123		10/05/18	1750 P
	Bearing Housing W/O Bearing				
AH173906	KIT	1	29.69		29.69
AH232566	LINK CHAIN	1	115.94		115.94
AH233198	Belt Set	1	163.30		163.30
AN207368	HYDRAULIC FI	1	76.88		76.88
	Hydraulic Filter				
AXE12964	Hydraulic Filte	1	61.37		61.37
	Hydraulic Filter				
AXE13435	Locking Collar	1	22.10		22.10
AXE13668	Sensor	1	52.93		52.93
AXE29101	Pressed Flanged	1	11.42		11.42
	Pressed Flanged Housing				
AXE39453	Bearing	4	29.33		117.32
BLACK	10.9 METRIC	81	.48		38.88
BPF11186	Bracket Kit	1	218.90		218.90
CRTY26783A	Wet Charged Bat	2-	72.00		144.00-
HXE11090	Filter	1	198.66		198.66
HXE11091	Filter Element	1	135.16		135.16
HXE15594	V-Belt	1 O	99.18		99.18
HXE82335	belt	1	226.54		226.54
HXE95511	V-Belt	1	120.40		120.40
H150133	SEAL	1	20.70		20.70
H154723	BELT	1	88.91		88.91
H165408	STRIP	2	36.64		73.28
H166181	SUPPORT	2	126.36		252.72
H171186	SHAFT	1	303.25		303.25
H171960	STRIP	3	25.77		77.31
H174818	RING	1	5.45		5.45
H214211	Deflector	12	5.87		70.44
H220121	Shaft	1	91.04		91.04

CONTINUED ON PAGE 04



JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

SAME AS BELOW

Invoice To:

BRYCE RICKLEFS INC
 10782 223RD AVE
 ANAMOSA IA 52205

Branch			
MONTICELLO, IA			
Date	Time	Page	
10/31/17	21:08:25 (B)	04	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W17232	
Ship Via		Purchase Order	
		S680	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS	
C024463	S680 corn combine	1465	1H0S680SHD0757578	10/05/14		
	S680	1123		10/05/18	1750 P	
H221044	Blade	6		47.75		286.50
H221045	Blade	6		47.75		286.50
H221379	SUPPORT	1		166.25		166.25
H228385	Chain Sprocket	1		46.18		46.18
JD39104	BALL BEARI	2		30.18		60.36
JD8554	ECCESTRIC	10		6.70		67.00
	Eccentric Locking Collar					
JD8665	BALL BEARI	3		9.28		27.84
L214634	Filter	1		15.66		15.66
PFP12435	Wiring Harness	1		211.38		211.38
PF81190	BRACKET KI	1		70.87		70.87
RE284091	AIR FILTER	1		57.33		57.33
RE533910	FUEL FILTER	1		115.83		115.83
RE539465	FILTER ELE	1		92.44		92.44
RE572785	Oil Filter	1		48.00		48.00
RS10	oil test	4		18.43		73.72
SUBLET	MONTI MACHINE	1 N		5.32		5.32
TY15630	BRACKET	1		36.99		36.99
TY26673	+50II 15W40 GL.	1		16.82		16.82
	Plus-50 II Oil 15W40 CJ4/SN					
TY26679	+50II 15W40 5GL	2		79.62		159.24
	Plus-50 II Oil 15W40 CJ4/SN					
TY26783A	Wet Charged Bat	2		320.33		640.66
	Wet Charged Battery					
CRTY26783A	Wet Charged Bat			72.00		144.00
TY26851	Fire Extinguish	1		89.99		89.99
	Fire Extinguisher					
TY26854	Fire Extinguish	1		142.49		142.49
	Fire Extinguisher					
03M7375	BOLT	6		1.10		6.60

CONTINUED ON PAGE 05



JOHN DEERE

BODENSTEINER IMPLEMENT COMPANY

1047 S Main St • Monticello, IA 52310

(319) 465-3515 • (800) 682-8153

Fax: (319) 465-3516



ELKADER • CLERMONT
 CRESCO • DECORAH • DYERSVILLE
 MONTICELLO • NEW HAMPTON
 OELWEIN • ROWLEY • WAUKON

www.bodimp.com

Ship To:

SAME AS BELOW

Invoice To:

BRYCE RICKLEFS INC
 10782 223RD AVE
 ANAMOSA IA 52205

Branch			
MONTICELLO, IA			
Date	Time	Page	
10/31/17	21:08:25 (B)	05	
Account No.	Phone No.	Invoice No.	
RICKL002	3194624435	W17232	
Ship Via		Purchase Order	
		S680	
		Salesperson	
		056	

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS	
C024463	S680 corn combine	1465	1H0S680SHD0757578	10/05/14		
	S680	1123		10/05/18	1750 P	
14M7300	FLANGE NUT	4		3.37		13.48
24M7242	WASHER	5		2.05		10.25
49M6480	SHAFT KEY	1		2.51		2.51
57M7019	BULB	1		13.48		13.48
57M9772	Elec. Connector	1 M		2.45		2.45
	Elec. Connector Housing					
57M9809	Elec. Connector	2 M		.57		1.14
	Elec. Connector Terminal					
80-744	SPRAY LUBE	1		14.12		14.12
				PARTS		6097.02
				LABOR		7973.10
				SUBLET		5.32
10600005				SEGMENT TOTAL==>		14075.44

***** WORK ORDER TOTALS *****

PARTS	6097.02
LABOR	7973.10
SUBLET	5.32
CLEANING/PWRWAS	20.00
Diagnostic Tech	10.00
HAZ MTL	12.50
SRVC ACCESSORY	25.00
TOURCH/WELDING	10.00
SUB TOTAL==>	14152.94
7% IOWA TAX- TAX 1	576.23
TOTAL FARMPLAN	14729.17

500924 1239641428



JOHN DEERE